



Service Bulletin

File in Section: -

Bulletin No.: 17-NA-383


Date: December, 2017

TECHNICAL


Subject: Malfunction Indicator Lamp (MIL) Illuminated with DTC P0446 or P0455 Set

This Bulletin replaces PIC6250B. Please discard PIC6250B.


Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore	2013	2017			All	All
Chevrolet	Sonic	2012	2017			All	All
Chevrolet	Trax	2013	2017			All	All

Involved Region or Country	North America
Condition	Some customers may comment on a malfunction indicator lamp (MIL) illuminated. During diagnosis, a technician may find DTC P0455 or P0446 set.
Cause	<div></div> <p>4646654</p> <p>This may be due to a restriction in the fresh air inlet port of the evaporator canister.</p>
Correction	Inspect and replace the canister if a restriction is found.

Service Procedure

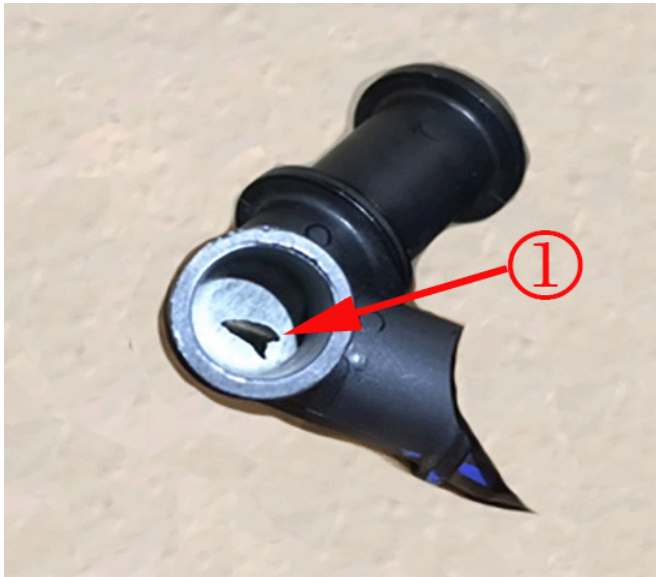

4646659

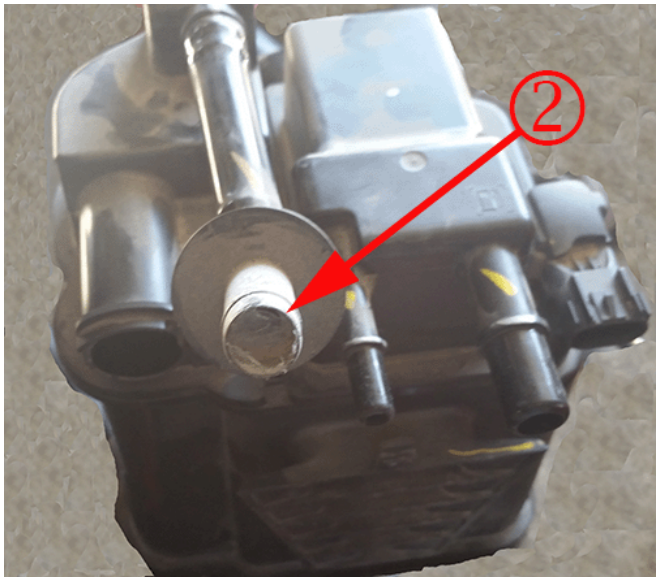

4646661

If you encounter a vehicle with the above concern, remove the evaporator canister vent cap and inspect the evaporator canister for spider nesting in the fresh air inlet port. Replace the evaporator canister. Refer to *Evaporative Emission Canister Replacement* in SI.

Parts Information

Refer to the electronic parts catalog (EPC) for obtaining the P/N for the evaporative emission canister.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4027950	Evaporative Emission Canister Replacement	Use Published Labor Operation Time

Version	1
Modified	Released November 29, 2017

