

## **Service Bulletin**

File in Section:

Bulletin No.: 17-NA-222

Date: September, 2017

# **TECHNICAL**

**Subject: Turbocharger Whine Noise** 

Brandi	Brand: Model:	Model Year:		VIN:		Engine:	Transmission:
Brand.		from	to	from	to		
Chevrolet	Colorado Express	2016	2018			LWN	All
GMC	Canyon Savana	2016	2018			LWN	All

Involved Region or Country	North America and N.A. Export Regions		
Additional Options (RPOs)	Equipped with 2.8L Diesel Engine (RPO LWN)		
Condition	Some customers may comment on a whine noise during acceleration, in gear, or Neutral.		
Cause This condition may be caused by a bent turbocharger compressor blade.			
Correction	Replace the turbocharger.		

#### **Parts Information**

Use the vehicle identification number (VIN), SI, and the GM Electronic Parts Catalog to determine the proper part to order.

Description	Part Number	Qty
TURBOCHARGER ASM	55486936	1
TURBOCHARGER ASM	55496255	1

### **Warranty Information**

Labor Operation	Description	Labor Time
4068290	Turbocharger Replacement	Use Published Labor Operation Time

#### **Service Procedure**

If you encounter a vehicle with the above concern, inspect the turbocharger compressor blades.



4818843

If one of the blades is bent as illustrated above, replace the turbocharger. Refer to *Turbocharger Replacement* in SI

If none of the blades are bent, continue diagnosis referring to SI.

Version	2
Modified	August 30, 2017 — Added 2018 Model Years.

Bulletin No.: 17-NA-222