



Service Bulletin

File in Section: -

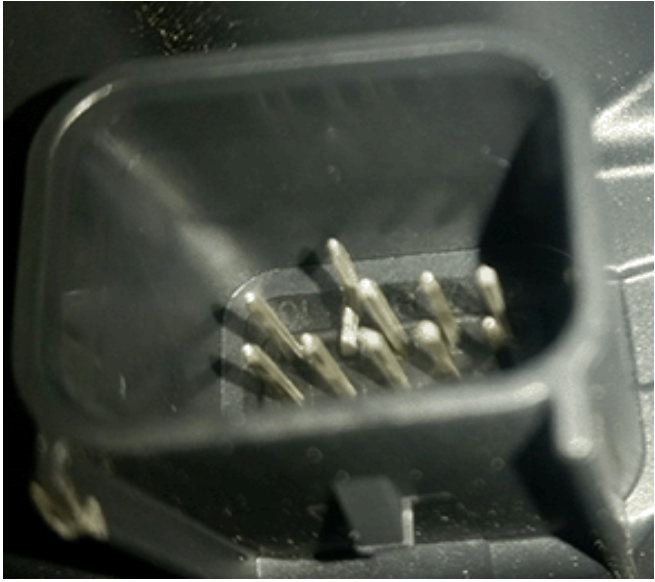
Bulletin No.: 17-NA-268

Date: August, 2017

TECHNICAL

Subject: Diagnostic Tip for Steering Reduced Message, Stabilitrak Message, Traction Control Lamp On, Malfunction Indicator Lamp (MIL) Illuminated

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Chevrolet	Equinox	2018	2018				

Involved Region or Country	North America and N.A. Export Regions
Condition	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> • Steering Reduced Message • Stabilitrak Message • Traction Control Lamp on • MIL <p>The technician may find one or more of the following DTCs set:</p> <ul style="list-style-type: none"> • U0121 • U0131 • U0151 • U0077 • U0077 • U0415 • U0422 • U1833
Cause	This condition may be caused by a bent terminal at the power steering gear electrical connector.
Correction	<div style="text-align: center;">  </div> <p style="text-align: right; font-size: small;">4815387</p> <p>Inspect the power steering gear electrical connection for bent terminals. If the terminals have been found bent, replace the steering gear.</p>

Parts Information

Description	Part Number	Qty
GEAR, ELEC DUAL PINION R/PINION STRG	84335343	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
7421750	Electric Dual Pinion Rack and Pinion Steering Gear Replacement	Use Published Labor Operation Time

Service Procedure

Refer to *Electric Dual Pinion Rack and Pinion Steering Gear Replacement* in SI.

Version	1
Modified	

