

1 11 07-17



Service Information Bulletin

SUBJECT	DATE
SPN 521483 (TCM)	November 2017

Additions, Revisions, or Updates

Publication Number / Title	Platform	Section Title	Change
DDC-SVC-MAN-0140	DT12	SPN 521483/FMI 16	This is a new section.

DiagnosticLink users: Please update the troubleshooting guides in DiagnosticLink with this newest version. To update the tool troubleshooting guide, open DiagnosticLink and from the Help – Troubleshooting Guides menu, select the appropriate troubleshooting manual, then click Update.



13400 Outer Drive, West, Detroit, Michigan 48239-4001
 Telephone: 313-592-5000
www.demanddetroit.com

2 SPN 521483/FMI 16 (TCM)

AMT - Over Temperature

Check as follows:

1. Connect DiagnosticLink[®] 8.06 or higher.
2. Turn the ignition ON (key ON, engine OFF).
3. Under the Instrumentation tab, monitor Transmission Control Module (TCM) instrument 2310 TCM Board Temperature. Is the temperature reading 143°C (290°F) or higher?
 - a. Yes; replace the TCM.
 - b. No; clear fault code. Cycle ignition. If code remains inactive, release vehicle; if code is still active, replace the TCM.