

K450 UPS8816-1BNAS1

TECHNICAL BULLETIN

11 JAN 2017



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Jaguar service facility to determine whether this bulletin applies to a specific vehicle.

INFORMATION

SECTION:501-05

SUBJECT/CONCERN:Update Prior to Sale: Luggage Compartment Lid Latch Cover Coming Adrift

AFFECTED VEHICLE RANGE:

MODEL:	MODEL YEAR:	VIN:	ASSEMBLY PLANT:
XF (X260)	2016-2017	Y05295-Y40300	Castle Bromwich

MARKETS:

NAS

CONDITION SUMMARY:**SITUATION:**

An issue has been identified on certain vehicles within the listed Affected Vehicle Range where the luggage compartment lid latch cover may either become loose or fall off into the luggage compartment. This does not affect the function of the luggage compartment lid latch.

ACTION:

Retailers are required to **HOLD** affected new vehicles that are within your control and refrain from releasing the vehicles for **new vehicle sale** pending completion of the Service Instruction detailed in this Technical Bulletin. Unsold vehicles should have this performed as part of the Pre-Delivery Inspection (PDI) process but **must** have it completed prior to vehicle handover to the customer.

This program does not apply to any vehicle already registered and in use, either with the retailer or customer. Any vehicle already in use may continue to be driven and any repair instructions deemed necessary will be communicated through a separate Field Action or Technical Bulletin.

PARTS:**NOTE:**

Order only the expected percentage demand of parts identified.

DESCRIPTION	PART NO./SUNDRY CODE	QTY./VALUE	EXPECTED % OF VEHICLES REQUIRING PARTS
Latch cover	T2H2192	1	100

SPECIAL TOOLS:

Refer to Workshop Manual/Service Instruction for any required special tools.

WARRANTY:

NOTE:

Check DDW to ensure that a vehicle is affected by this program prior to undertaking any rework action.

At the time of confirming a booking for vehicle repair, ensure that **all** outstanding Recalls and Service Actions are identified to ensure the correct parts are available and adequate workshop time is allocated for repairs to be completed at one visit.

Warranty claims must be submitted quoting the Program Code together with the relevant Option Code. SRO and parts information is included for information only. The Option Code(s) that allows for the drive in / drive out allowance can only be claimed if the vehicle is brought back into the workshop for this action alone to be undertaken.

Repair procedures are under constant review and therefore times / prices are subject to change; those quoted here must be taken as guidance only. Refer to TOPIx to obtain the latest repair time.

This program is valid for a limited time only. Warranty claims with a repair date prior to the **06 July 2017** closure date must be submitted or payment within 30 calendar days of completion of the repair.

PROGRAM CODE	OPTION CODE	DESCRIPTION	SRO	TIME (HOURS)	PARTS/SUNDRY CODE	QTY./VALUE
K450	B	Luggage compartment lid latch cover modification	76.20.32	0.10	T2H2192	1
K450	C	Luggage compartment lid latch cover modification Drive in/drive out	76.20.32 10.10.10	0.10 0.20	T2H2192 -	1 -
K450	D	Luggage compartment lid latch cover modification Transit disengage/re-engage	76.20.32 86.93.93	0.10 0.10	T2H2192 -	1 -
K450	E	Luggage compartment lid latch cover modification Transit disengage/re-engage Drive in/drive out	76.20.32 86.93.93 10.10.10	0.10 0.10 0.20	T2H2192 - -	1 - -

Normal Warranty policies and procedures apply.

SERVICE INSTRUCTION:

-
- 1 Open the luggage compartment lid.
-

2 

Remove the luggage compartment lid bump stops (where applicable).


3 

Remove the two fasteners.

4




Remove and discard the luggage compartment lid latch cover.

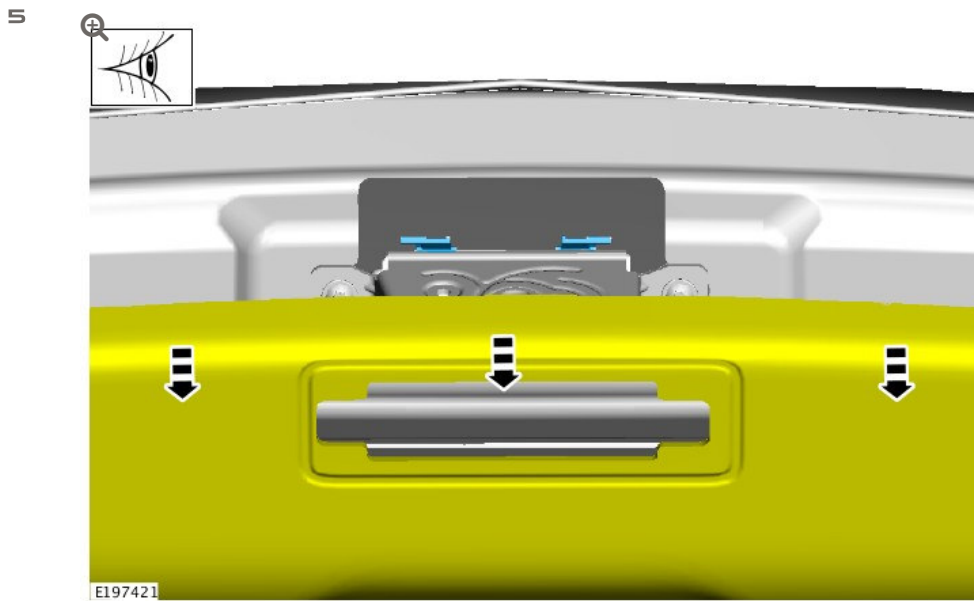

Pull the luggage compartment lid carpet trim down as shown and visually check the latch assembly clipping features are intact and not damaged.

NOTE:

Working on the luggage compartment lid carpet trim and starting from one end of the area shown.

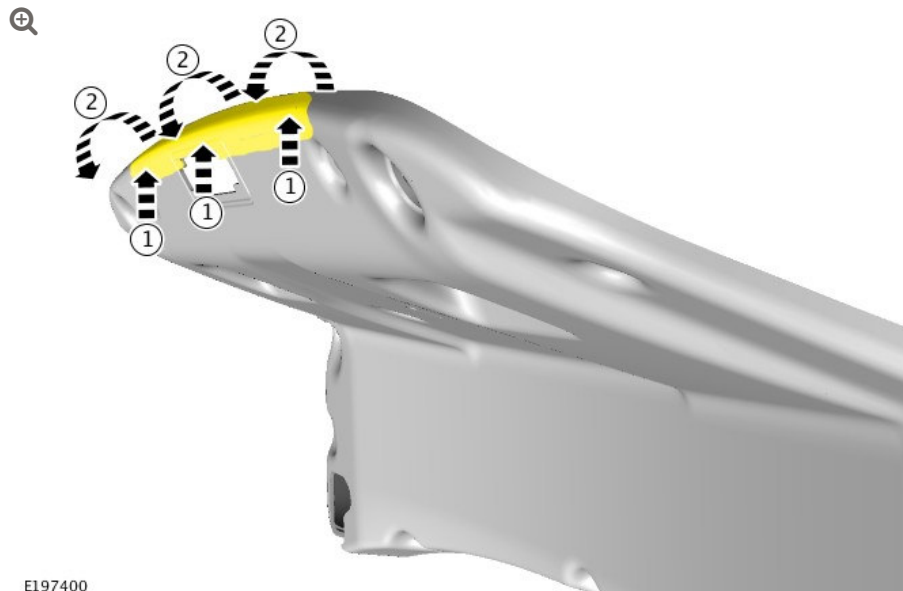

E197400

Push in at (1) whilst bending the top edge (2) towards you to flatten any high points on the return edge.

- Work along the area shown.

7

NOTE:


Make sure not to bend the legs too far.



E197237

Bend the legs on the new luggage compartment lid latch cover in the direction shown by approximately 10 degrees.

8

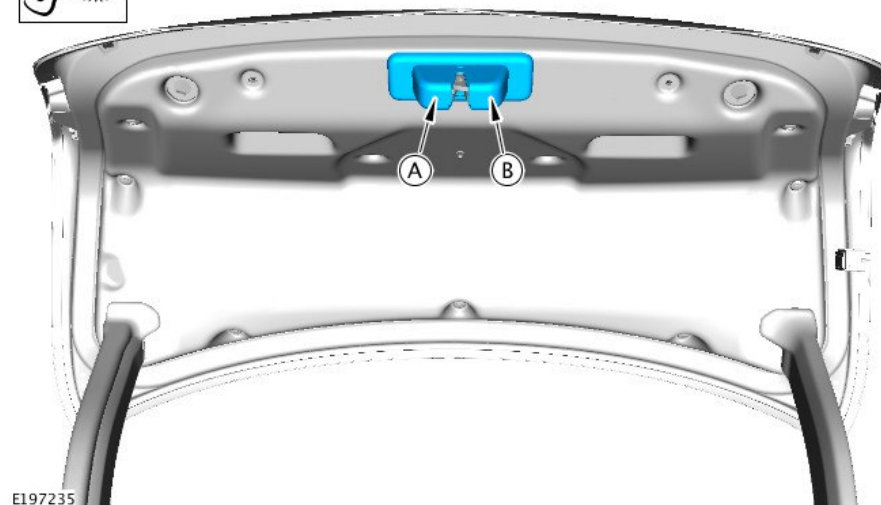


E197235

Install the new luggage compartment lid latch cover by pushing with the palm of your hand on the center of the latch cover until a click noise is heard.

- Push an additional time on each side of the latch at points **A** and **B** to check both clips have latched correctly.

9

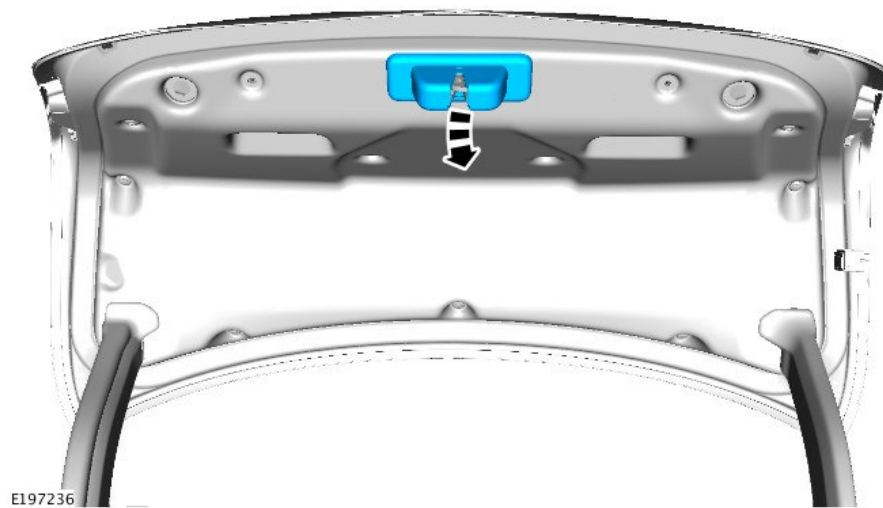

Pull the luggage compartment lid down by pulling on the luggage compartment lid latch cover to confirm the integrity of the installation.

- If the luggage compartment lid latch cover becomes detached at this stage, repeat Steps 6-8.

10



Install the two fasteners.

11



Install the luggage compartment lid bump stops (where applicable).

-
- 12 Close the luggage compartment lid.