

Manual Seat is Difficult to Slide Back/Forth

Service Category Vehicle Interior

Section Seat

Market USA

Toyota Supports
 ASE Certification 

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2014 - 2016	Tundra	

Introduction

Some 2014 – 2016 model year Tundra vehicles may exhibit difficulty in adjusting seat position (forward or backward) on manual seats. This is due to the seat position adjustment lever interfering with the seat cushion. Follow the Repair Procedure in this bulletin to address this condition.

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VINs shown below.

MODEL	PLANT	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
Tundra	TMMTX	2WD	5TFRM5F1#GX098380
			5TFEM5F1#GX098368
			5TFEW5F1#GX197684
			5TFEY5F1#GX197666
			5TFNW5F1#GX197596
			5TFNY5F1#GX197618
			5TFRW5F1#GX197663
			5TFRY5F1#GX197674
			5FTW5F1#GX009073
			5FTY5F1#GX009069
		4WD	5FCW5F1#GX019540
			5FCY5F1#GX019539
			5FDW5F1#GX512400
			5FDY5F1#GX512246

Manual Seat is Difficult to Slide Back/Forth

Production Change Information (Continued)

MODEL	PLANT	DRIVETRAIN	PRODUCTION CHANGE EFFECTIVE VIN
Tundra	TMMTX	4WD	5TFPW5F1#GX511737
			5TFUW5F1#GX512343
			5TFUY5F1#GX512499
			5TFUM5F1#GX065338
			5TFDM5F1#GX065335

Warranty Information

OP CODE	DESCRIPTION	TIME	OFF	T1	T2
BD1610	R & R Front Seat Cushion and Cushion Cover	1.5	See "Parts Information"	97	57

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Parts Information

PART NUMBER		PART NAME	QTY
PREVIOUS	NEW		
71511-0C330	71511-0C331	Pad, Front Seat Cushion	1
71511-0C340	71511-0C341		
71512-0C110	71512-0C111		
71071-0C650-B3	71071-0C651-B3	Cover Sub-Assy, Front Seat Cushion	1
71071-0C670-B3	71071-0C671-B3		
71071-0C670-C3	71071-0C671-C3		
71071-0C670-E2	71071-0C671-E2		
71071-0C780-B3	71071-0C781-B3		
71071-0C780-C4	71071-0C781-C4		
71071-0C780-E2	71071-0C781-E2		
71071-0C801-B2	71071-0C802-B2		
71071-0C801-C3	71071-0C802-C3		

Manual Seat is Difficult to Slide Back/Forth

Parts Information (Continued)

PART NUMBER		PART NAME	QTY
PREVIOUS	NEW		
71071-0C801-E2	71071-0C802-E2	Cover Sub-Assy, Front Seat Cushion	1
71071-0C760-C1	71071-0C761-C1		
71071-0C830-C0	71071-0C831-C0		
71072-0C440-B3	71072-0C441-B3		
71072-0C450-B3	71072-0C451-B3		
71072-0C450-C3	71072-0C451-C3		
71072-0C450-E2	71072-0C451-E2		

Repair Procedure

1. In a seating position, confirm seat sliding effort.
 Does the seat slide without ANY difficulty or without interference between the seat position adjustment lever and the seat cushion?
 - **YES** — This bulletin does NOT apply. Continue diagnosis using the applicable Repair Manual.
 - **NO** — Continue to step 2.

2. Replace the affected seat cushion cover and seat pad with NEW parts.
 Refer to the Technical Information System (TIS), applicable model and model year Repair Manual:
 - 2014 Tundra:
Vehicle Interior – Seat – “Seat: Front Seat Assembly (for Manual Seat): [Removal](#) / [Disassembly](#) / [Reassembly](#) / [Installation](#)”
 - 2015 Tundra:
Vehicle Interior – Seat – “Seat: Front Seat Assembly (for Manual Seat): [Removal](#) / [Disassembly](#) / [Reassembly](#) / [Installation](#)”
 - 2016 Tundra:
Vehicle Interior – Seat – “Seat: Front Seat Assembly (for Manual Seat): [Removal](#) / [Disassembly](#) / [Reassembly](#) / [Installation](#)”

3. In a seating position, verify the seat does slide forward/backward.