



MISSING AUDIO NOTIFICATION WHEN STORING SEAT MEMORY

MODEL

F22 (2 Series Coupe)	F23 (2 Series Convertible)	F30 (3 Series Sedan)	F31 (3 Series Sport Wagon)
F32 (4 Series Coupe)	F33 (4 Series Convertible)	F34 (3 Series Gran Turismo)	F36 (4 Series Gran Coupe)

Produced through October 31, 2016

Only vehicles with option code 0456 (Multi-contour seats) or/and option code 0459 (Power Front Seats) and vehicles **without** option code 0609 (Navigation system)

SITUATION

When saving seat memory settings (Memory 1 or Memory 2) with a vehicle **without** navigation, there is no audio tone confirmation.

CAUSE

Software error in control unit of Seat Module 2.

CORRECTION

Reprogram and code vehicle with ISTA/P or ISTA 4.

PROCEDURE

For conditions that are similar to the situation described:

1. Perform diagnosis with the latest version of ISTA.
2. Program the vehicle using ISTA/P 3.60.0 or ISTA 4.02.10 or higher.

F22 (2 Series Coupe)	Target integration level: 16-07-50x or higher
F23 (2 Series Convertible)	
F30 (3 Series Sedan)	
F31 (3 Series Sport Wagon)	
F32 (4 Series Coupe)	

F33 (4 Series Convertible)
F34 (3 Series Gran Turismo)
F36 (4 Series Gran Coupe)

Note that ISTA/P/ISTA 4 will automatically reprogram and code all programmable control modules that do not have the latest software.

Always connect a BMW approved battery charger/power supply ([SI B04 23 10](#)).

For information on programming and coding with ISTA/P/ISTA4, refer to CenterNet / TIS / Technical Documentation / Diagnostics and Programming / Programming Documentation.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks or the BMW Certified Pre-Owned Program.

Defect Code:	6135691500	
Labor Operation:	Labor Allowance:	Description:
00 00 006	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Main work)
Or:		
00 00 556	Refer to KSD2	Performing "vehicle test" (with vehicle diagnosis system – checking faults) (Plus work)
And:		
61 21 528	Refer to KSD2	Connect an approved battery charger/power supply (indicated in KSD 2 as Charging battery)
And:		
61 00 730	Refer to KSD2	Programming/encoding control unit(s)

If you are using a Main labor code for another repair, use the Plus code labor operation 00 00 556 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

Vehicle Programming and Coding

When ISTA/P/ISTA4 automatically reprograms and codes all the vehicle's control modules that "currently do not have" the latest software and if one or more control module failures occur "during"

this programming procedure:

- Please claim this “consequential” control module-related repair work under the defect code listed in this bulletin with the applicable KSD2/AIR labor operations.

Other Repairs

Control module failures that occurred “prior” to performing this programming procedure:

- When “covered” under an applicable limited warranty, claim this control module-related repair work using the applicable defect code and labor operations in KSD2/AIR.

[Copyright ©2017 BMW of North America, Inc.]