



SI B61 05 17  
General Electrical Systems

February 2017  
Technical Service

## WINDOW WASHER FLOW INTERRUPTION

### MODEL

G30 (5 series Sedan)	
Produced through November 15, 2016	

### SITUATION

Front windshield washers spray poorly or not at all.

### CAUSE

Partially or completely pinched supply tube caused by misplaced tube holder on hood hinge.



### CORRECTION

Reposition and secure tube holder on the gas pressure spring.

### PROCEDURE

For conditions that are similar to the situation described:

	<ol style="list-style-type: none"> <li>Using double-sided tape on the holder where shown, secure the tube holder onto the gas-pressure spring to prevent twisting.</li> </ol>
--	---



GRUSB6117-03

- Using a cable tie (part number 31 13 1 357 599), attach the tube to the holder observing the dimensions shown.

## PARTS INFORMATION

Part Number	Description	Quantity
61 13 1 367 599	Cable tie	1
83 19 0 445 309*	Double-sided adhesive tape (L=66m, W=19mm)	As needed

\*Or a locally-sourced equivalent

## WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

<b>Defect Code:</b>	<b>6166024800</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
61 99 000	3 FRU	Work time to install double-sided tape and a cable tie on the tube holder (Main work)
Or		
61 99 000	2 FRU	Work time to install double-sided tape and a cable tie on the tube holder (Plus work – Vehicle is already in the workshop)

And, as needed:

### Sublet – Bulk Materials

<b>Sublet Code 4</b>	See sublet reimbursement	Reimbursement for the used quantity of repair-related bulk material, please do
----------------------	--------------------------	--

	calculation below	
--	-------------------	--

		not use part number 83 19 0 445 309 for claim submission
--	--	---

Sublet reimbursement calculation for claiming the used quantity of repair-related bulk material:

- The BMW part number is at dealer net plus your center's handling, or
- Locally-sourced double-sided adhesive tape is "at cost with no handling."

[ Copyright ©2017 BMW of North America, Inc. ]