



DELIVERY STOP SERVICE ACTION: CHECK REAR VENTS

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

MODEL

F25 (X3)	F26 (X4)
----------	----------

AFFECTED VEHICLES

This Service Action involves (9) F25 or F26 produced on January 6, 2017

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION

Rear vents may not have been installed properly.

Improper installation may result in water leakage into the luggage compartment.

CAUSE

Manufacturing error.

CORRECTION


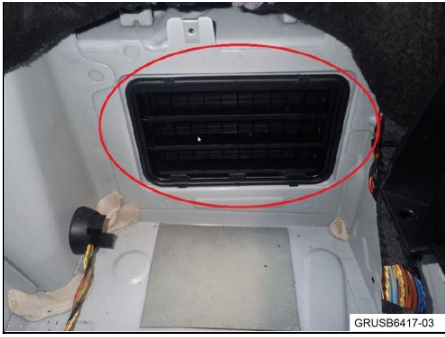

Visually inspect the rear vents on both sides and correct any connection deficiencies.

PROCEDURE

For right rear vent:



1. Remove the luggage compartment flap on the right side.
2. Remove the storage compartment in the right side.

 <p>GRUSB6417-02</p>	<p>3. Remove the cover on the rear vent for the right side.</p>
 <p>GRUSB6417-03</p>	<p>4. Check the rear vent at the indicated position (see photo) for tight fit.</p> <p>If the rear vent is not connected properly, it must be corrected.</p>
<p>For left rear vent:</p>  <p>GRUSB6417-04</p>	<ol style="list-style-type: none"> 1. Remove the luggage compartment flap for the left side 2. Remove the cover on the rear vent for the left side. 3. Remove the cover on the rear vent for the right side. 4. Check the rear vent at the indicated position for tight fitting similar to right side. <p>If the rear vent is not connected properly, it has to be corrected.</p>

Put all removed parts back in place for both sides.

WARRANTY INFORMATION

Reimbursement for this Delivery Stop Service Action will be via normal claim entry utilizing the following information:

<p>Defect Code:</p>	<p>0064920100</p>
----------------------------	--------------------------

Completion “before” vehicle delivery to the customer or the vehicle is already in the workshop

Labor Operation:	Labor Allowance:	Description:
00 64 853	3 FRU	Check the rear vent, no repair is necessary (Plus work)
Or:		
00 64 295	5 FRU	Check the rear vent, no repair is necessary (Main work)

Or:

If applicable, completion after vehicle delivery to the customer

Labor Operation:	Labor Allowance:	Description:
00 64 854	3 FRU	Check and repair the rear vent (Plus work)
Or:		
00 64 296	5 FRU	Check and repair the rear vent (Main work)

[Copyright ©2017 BMW of North America, Inc.]