



SERVICE ACTION: REPLACE ACTIVATED CHARCOAL FILTER AND NVLD SENSOR HOLDER

UPDATE! What's New:

- **Procedure, parts and warranty added.**

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

This Service Information bulletin replaces SI B16 01 17 **dated February 2017**

MODEL

F25 (X3)	F26 (X4)
----------	----------

AFFECTED VEHICLES

This Service Action involves F25 and F26 vehicles produced from February 2017 to March 2017.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION

The activated charcoal canister and or NVLD sensor holder may be damaged.

CAUSE


Transportation damage.

CORRECTION

Replace activated charcoal canister and NVLD sensor holder if found damaged.

UPDATE! PROCEDURE

	<ol style="list-style-type: none"> 1. Inspect the mounting brackets (1-3) in the illustration located on the activated charcoal canister.
--	--

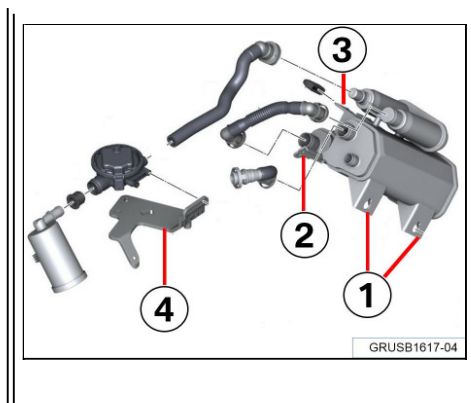

Inspect the NVLD sensor holder (4).

Refer to repair instruction 16 12 010 "Replace the activated charcoal canister".

2. Replace the activated carbon canister and the NVLD sensor holder if found cracked or deformed.

UPDATE! PARTS INFORMATION

Please refer to the Parts Matrix for parts ordering procedure.

F25 and F26 with the N20 engine:

Part Number	Description	Quantity
16 13 7 293 757	Activated Charcoal Filter	1
16 13 7 318 343	Holder (NVLD)	1
07 14 7 194 471	Screw for plastic	3
07 11 9 905 871	Hex bolt with washer	4

F25 and F26 with the N55 engine:

Part Number	Description	Quantity
16 13 7 279 362	Activated Charcoal Filter	1
16 13 7 318 343	Holder (NVLD)	1
07 14 7 194 471	Screw for plastic	3
07 11 9 905 871	Hex bolt with washer	4

UPDATE! WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	0016210200
---------------------	-------------------

Completion before vehicle delivery to the customer or the vehicle is already in the workshop.

Labor Operation:	Labor Allowance:	Description:
-------------------------	-------------------------	---------------------

00 64 935	6 FRU	Replacing the activated carbon canister with holder (Plus work)
-----------	-------	---

Or:

Completion after vehicle delivery to the customer

Labor Operation:	Labor Allowance:	Description:
00 64 339	8 FRU	Replacing the activated carbon canister with holder (Main work)

ATTACHMENTS

View PDF attachment [B160117 VIN List](#).

View PDF attachment [B160117 Delivery Stop Legal](#).

[Copyright ©2017 BMW of North America, Inc.]