



LUGGAGE ROLLER COVER: DIFFICULTY SECURING INTO BRACKET

MODEL

F31 (3 Series Sports Wagon)

SITUATION

When attempting to secure or release the luggage cover roller into/from the left bracket, it will not easily secure/release.

CAUSE

Left bracket is not accurately installed.

CORRECTION

Adjust mounting position of left luggage cover roller bracket.

PROCEDURE

For conditions that are similar to the situation described:

1. Remove luggage cover roller.
2. Loosen both bolts securing left roller-mounting bracket. Reposition bracket approx. 2mm outward (toward left side of vehicle).



3. Screw-in bracket bolts just until they are finger-tight.
4. Check the position of the bracket by attempting to attach/detach the cover roller into/from the bracket.

Is the roller cover now easily secured/removed into/from the bracket?

YES– go to the next step.

NO – repeat the procedure from Step 1.

5. Tighten the mounting bolts.

Tightening Force: 4.0 NM +/- 1.0

6. Recheck securing/release of cover roller after final assembly.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle Limited Warranty for Passenger Cars and Light Trucks.

Defect Code:	5147082900	
Labor Operation:	Labor Allowance:	Description:
51 47 145	Refer to KSD2	Removing and installing/replacing roller cover for luggage compartment (Main work)
Or:		
51 47 645	Refer to KSD2	Removing and installing/replacing roller cover for luggage compartment (Plus work)
And:		
51 99 000	2 FRU	Adjust mounting bracket for luggage compartment roller cover.

If you are using a Main labor code for another repair, use the Plus code labor operation 51 47 645 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

Work time labor operation code 51 99 000 is not considered a Main labor operation. Also, since the “work time” FRU allowance to be claimed is specified, a separate punch time is not required.

[Copyright ©2017 BMW of North America, Inc.]