



SI B11 08 17
Engine

April 2017
Technical Service

SERVICE ACTION: REPLACE THE TURBOCHARGER COOLANT LINES (S63)

MODEL

F10 (5 Series Sedan M5)	F06 (6 Series Gran Coupe M6)	F12 (6 Series Convertible M6)	F13 (6 Series Coupe M6)
-------------------------	------------------------------	-------------------------------	-------------------------

With the S63 engine

AFFECTED VEHICLES

This Service Action involves certain F06, F10, F12 and F13 (M5 and M6) vehicles produced from March 2, 2012 to February 20, 2017

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION

The coolant lines running into the turbochargers may develop a leak over time.

CAUSE

Material used for the coolant lines may not withstand prolonged turbocharger temperatures.

CORRECTION

Replace the coolant lines for the turbochargers.

PROCEDURE

Replace the coolant lines following compatible **Repair Instruction for the N63R: REP 11 53 091 Replacing coolant hoses for exhaust turbocharger (also attached).**

PARTS INFORMATION

Part Number	Description	Quantity
11 53 8 092 360	Exhaust turbocharger coolant line set	1

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	0011570400	
Labor Operation:	Labor Allowance:	Description:
00 64 957	8 FRU (F06/F12/F13); 9 FRU (F10)	Replacing the exhaust turbocharger coolant hoses (Plus work)

And:

Sublet – Bulk Materials

Sublet Code 4	\$5.00 Maximum	Reimbursement for replacing the drained quantity of antifreeze/coolant (Bulk container reference 82 14 1 467 704, one gallon container. Do not use this part number for claim submission)
---------------	----------------	-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

Sublet calculation: BMW antifreeze/coolant (1 gallon bulk container reference P/N 82 14 1 467 704) for “approximately 1 liter (2 liter solution total)” that is needed for this repair (50/50 mixture) at dealer net plus your center’s handling.

Enter this material cost in sublet and itemize the amount on the repair order and in the claim comment section.

ATTACHMENTS

View PDF attachment [11 53 091 Replacing the coolant hoses for the turbochargers.](#)

[Copyright ©2017 BMW of North America, Inc.]