



## FUEL LEVEL LED INDICATOR – INCOMPLETE

### MODEL

F60 (Cooper, Cooper S Countryman)			
-----------------------------------	--	--	--

Produced from 11/1/16 through 12/12/16

### SITUATION

Fuel level indicator upper LED does not illuminate even though tank has been filled until auto-shutoff.



### CAUSE

Pressure relief valve in fuel tank closes too early.

### CORRECTION

Replace fuel tank.

### PROCEDURE

For conditions that are similar to the situation described:

1. Drain the fuel tank according to REP11 00 005
2. Remove the fuel delivery unit following repair instruction REP 16 14 090.
3. Remove and replace the fuel tank according to repair instruction REP16 00 XXX
4. Reinstall the fuel delivery unit following repair instructions.

### PARTS INFORMATION

--	--	--

Part Number	Description	Qty
16 11 7 453 430	Fuel tank	1

Also refer to ETK/EPC and the repair instructions for onetime-use fasteners/screws and other information regarding repair-related gaskets and seals that also need to be replaced/used and claimed.

## WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty.

<b>Defect Code:</b>	<b>1611009400</b>	
<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
See KSD2 Main Group "16"	Refer to KSD2	Extracting fuel from the fuel tank and filling (Select the applicable Plus work labor operation (16 00 010 to 16 00 050) that applies to the amount of fuel extracted – 10 liter increments) (Main work)
Or:		
See KSD2 Main Group "16"	Refer to KSD2	Extracting fuel from the fuel tank and filling (Select the applicable Plus work labor operation (16 00 610 to 16 00 650) that applies to the amount of fuel extracted – 10 liter increments) (Plus work)
And:		
16 11 535	Refer to KSD2	Replacing fuel tank (includes removing and installing exhaust system) (Plus work)

If you are using a Main labor code for another repair, use the Plus code labor operation for "Extracting fuel" that applies instead (16 00 610/16 00 650).

Or:

<b>Labor Operation:</b>	<b>Labor Allowance:</b>	<b>Description:</b>
16 11 031	Refer to KSD2	Replacing fuel tank (includes removing and installing exhaust system) (Main work)
Or:		

16 11 535	Refer to KSD2	Replacing fuel tank (includes removing and installing exhaust system) (Plus work)
And:		
See KSD2 Main Group "16"	Refer to KSD2	Extracting fuel from the fuel tank and filling (Select the applicable Plus work labor operation (16 00 610 to 16 00 650) that applies to the amount of fuel extracted – 10 liter increments) (Plus work)

If you are using a Main labor code for another repair, use the Plus code labor operation 16 11 535 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances.

[ Copyright ©2017 BMW of North America, Inc. ]