



SI M61 01 17
General Electrical Systems

April 2017
Technical Service

WINDSHIELD WASHER SYSTEM NOT WORKING

MODEL

F60 (Cooper, Cooper S, JCW Countryman)


SITUATION

The windshield washer reservoir is filled but no fluid is dispensed onto windshield when system is activated.

CAUSE

Restriction of supply hose caused by:

- Kink in hose
- Incorrect hose routing
- Pinched in hood closure

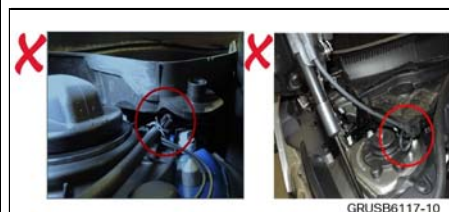

CORRECTION

Reroute washer hose to eliminate restriction to fluid flow.

PROCEDURE

For conditions that are similar to the situation described:

Route the hose so that it is clipped to the hood gas pressure spring eliminating any kinks or sharp bends. Also check the area where the hose enters the cowl trim as seen below and correct as needed.



PARTS INFORMATION

Note: Parts replacement is only required in the event of permanent hose damage.

In most cases, once the hose is correctly routed, the washers will begin to operate normally

Part Number	Description	Quantity
61 66 7 380 748	Hose line, windscreen washer system	1

WARRANTY INFORMATION

Covered under the terms of the MINI New Passenger Car Limited Warranty.

Defect Code:	6166021300	
---------------------	-------------------	--

A. Re-routing the Washer Hose to Eliminate the Restriction Only

Labor Operation:	Labor Allowance:	Description:
61 99 000	3 FRU	Work time for Rerouting the washer hose to Eliminate Restriction (Main work)
Or:		
61 99 000	2 FRU	Work time for Rerouting the washer hose to Eliminate Restriction (Plus work – Vehicle already in the workshop)

Or:

B. Replacing the Washer Hose when Re-routing the Washer Hose does not Eliminate the Restriction

Labor Operation:	Labor Allowance:	Description:
61 71 250	Refer to KSD2	Removing and installing/replacing the window washer system hose pipe (Main

		work)
Or:		
61 71 750	Refer to KSD2	Removing and installing/replacing the window washer system hose pipe (Plus work)
And:		
61 99 000	2 FRU	Work time to attempt re-routing of the washer hose to Eliminate Restriction

If you are using a Main labor code for another repair, use the Plus code labor operation 61 71 750 instead.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowances

Item “B”: Work time labor operation code 61 99 000 is not considered a Main labor operation. Also, since the “work time” FRU allowance to be claimed is specified, a separate punch time is not required.

[Copyright ©2017 BMW of North America, Inc.]