 
TIS Service Bulletin Page 1 of 2



August 2017 Technical Service

SERVICE ACTION: REPLACE CONVERTIBLE TOP COMPARTMENT LID TRIM

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

MODEL

- 10 (0 0 ·)		
F12 (6 Series		
Convertible)		
Oditvertible)		

AFFECTED VEHICLES

This Service Action involves certain F12 6 Series produced between January and June of 2017.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION

Temporary convertible top compartment cover trim was installed in production due to parts shortage. Vehicle cannot be delivered while equipped with temporary cover.



CAUSE

Temporary trim does not provide adequate seal.

CORRECTION

nstall permanent convertible top compartment cover trim.

PROCEDURE

For affected vehicles that show issue as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader:

Replace the temporary cover as per "REP 51 17 001 Removing (replacing) & installing cover of soft top compartment lid".

TIS Service Bulletin Page 2 of 2



Warning: Danger of injury, refer to repair instructions "RA 521 17 001" for safety warnings.

There is an approx. 20 second delay, after the ignition has been switched off, before the soft top system is depressurized.

The soft top compartment lid then lowers automatically.

PARTS INFORMATION

Part Number	Description	Quantity
51 17 7 227 798	Trim	1
51 17 7 284 113	Sealing Tape	1

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	0054520100	
Labor Operation:	Labor Allowance:	Description:
00 65 545	15 FRU	Replacing the trim for the convertible top
00 65 545	13 FKU	compartment lid (Plus work)

[Copyright ©2017 BMW of North America, Inc.]