

SI B26 05 16
DriveshaftSeptember 2017
Technical Service

Service Action: Replace the Flexible Disc on the rear driveshaft

New information provided by this revision is preceded by this symbol .

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

This Service Information bulletin replaces SI B26 05 16 **dated December 2016**.

What's New:

- Consequential statement and Overlapping Labor procedure added to the Warranty Information section.

MODEL

F01 (7 Series)	F02 (7 Series LWB)		
----------------	--------------------	--	--

With xDrive

AFFECTED VEHICLES

This Service Action involves F01 and F02 vehicles produced March 1, 2011 to April 29, 2011.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION

The flexible disc (giubo) that connects the rear driveshaft to the transfer case may crack.

CAUSE

Excessive angular load on the flexible disc on the driveshaft

CORRECTION

Replace the flexible disc on the rear driveshaft.

PROCEDURE

Refer to Repair Instruction **26 11 051 Replacing flexible disc for front propeller shaft**

PARTS INFORMATION

Part Number	Description	Quantity
26 11 7 610 061	Flexible disc	1
26 11 7 635 643	Hexagon head bolt	6
26 12 7 536 563	Self-locking hexagon nut	6

18 30 7 577 959	Sealing ring	2
18 30 7 597 650	Collar nut	4

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	0026290100	
Labor Operation:	Labor Allowance:	Description:
00 64 223	Refer to KSD2	Replacing the flexible disc for the propeller shaft (Main work)
Or:		
00 64 756	Refer to KSD2	Replacing the flexible disc for the propeller shaft (Plus work)

UPDATE !

If you are using a Main labor code for another repair, use the Plus code labor operation 00 64 765 instead of 00 64 223.

UPDATE !

Consequential Repair(s)

When additional/other work and/or parts are required as a “**direct result**” of the issue described in this bulletin, claim these items under the defect code listed above together the applicable labor operations listed in KSD2

Overlapping Labor Procedure – Other Repairs

If invoicing the KSD2 flat rate labor operation codes for other repair work results in overlapping labor, for those flat rate labor operations that are affected, you can now:

- Replace the stated KSD2 “FRU allowance” with a “reduced FRU value” to eliminate the overlapping labor.

For help in identifying the overlapping labor, please refer to the AIR FRU Plausibility Check (Overlapping Labor Tool) that is located in the AIR Client.

Eligible other repair work being claimed under a different defect code will require separate punch times.

On the repair order and in the claim comment section, please identify and itemize those labor operations being claimed with a “reduced FRU value.”

Tuesday, September 12, 2017

ATTACHMENTS

View PDF attachment [SI B260516 Customer Notification Letter](#).

[Copyright ©2017 BMW of North America, Inc.]