



SI M51 04 17
Body Equipment

September 2017
Technical Service

SERVICE ACTION: HOOD RELEASE BOWDEN CABLE POSITIONING

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

MODEL

F60 (Cooper, Cooper S, JCW Countryman)			
--	--	--	--

AFFECTED VEHICLES

This Service Action involves (4) F60 vehicles.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION

Tank ventilation line and/or hood release Bowden cable may have been damaged.

CAUSE

The hood release Bowden cable is unsecured and in contact with the tank ventilation line.

CORRECTION

Secure the hood-release Bowden cable to the body with a wire tie.

PROCEDURE

For conditions that are similar to the situation described:

	1. Check the condition of the tank ventilation line and hood-release Bowden cable at point of contact (right side of engine compartment) where indicated. Were any parts damaged? YES- replace the damaged parts (as specified in EPC), if required, then go to next step. Refer to RA 51 23 211 "Removing and installing/replacing cable for front engine compartment locks (in engine compartment) and/or 13 90 500 "Replacing the vent valve". NO – go to next step.
	2. Reposition the hood-release Bowden cable away from the tank ventilation line.



3. Secure both hood-release Bowden cables to the body with a wire tie as shown.

PARTS INFORMATION

Part Number	Description	Quantity
61 13 1 367 599	Cable tie	1

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Defect Code:	0051180400	
Labor Operation:	Labor Allowance:	Description:
00 65 710	3 FRU	Rework cable, check lines (Plus work)
Or:		
00 65 711	6 FRU	Rework cable, check & replace vent line (Plus work)
Or:		
00 65 712	8 FRU	Rework cable, check & replace cable (Plus work)
Or:		
00 65 713	14 FRU	Rework cable, check & replace both, a cable & a vent line (Plus work)

And, as applicable:

Alternative Mobility Solutions (AMS) Reimbursement

This Service Action repair qualifies for Alternative Mobility Solution (AMS) expense reimbursement, please claim this item under the Defect Code noted above as follows:

Sublet Code "2"	See below	Alternative Mobility Solution (AMS) expense reimbursement
------------------------	-----------	---

Claimable AMS-related reimbursement items and allowances (at cost, no markup)

- Mass transit (Up to \$15.00);

- Taxi and livery services (Up to \$15.00);
- “On-demand” Phone app-based transportation services (Up to \$15.00); or
- Vehicle pickup/drop off service “to and/or from” a customer’s home or business location (Up to \$25.00).

Please refer to SI M01 01 17 for additional information. Itemize this sublet amount on the repair order and in the claim comment section.

[Copyright ©2017 BMW of North America, Inc.]