



Service Action: Replace the Flexible Disc on the rear driveshaft

New information provided by this revision is preceded by this symbol .

Please perform the procedure outlined in this Service Information on all affected vehicles before customer delivery. In the event the customer has already taken delivery of the vehicle, please perform the procedure the next time the vehicle is in the shop.

This Service Information bulletin replaces SI B26 05 16 **dated December 2016**.

What's New:

- A new Plus Code labor operation has been added. Refer to the Warranty section

MODEL

| | | | |
|----------------|--------------------|--|--|
| F01 (7 Series) | F02 (7 Series LWB) | | |
|----------------|--------------------|--|--|

With xDrive

AFFECTED VEHICLES

This Service Action involves F01 and F02 vehicles produced March 1, 2011 to April 29, 2011.

Vehicles which require this Service Action to be completed will show it as "Open" when checked either in AIR, the "Service Menu" of DCSnet (Dealer Communication System) or with the Key Reader.

SITUATION

The flexible disc (giubo) that connects the rear driveshaft to the transfer case may crack.

CAUSE

Excessive angular load on the flexible disc on the driveshaft

CORRECTION

Replace the flexible disc on the rear driveshaft.

PROCEDURE

Refer to Repair Instruction **26 11 051 Replacing flexible disc for front propeller shaft**

PARTS INFORMATION

| Part Number | Description | Quantity |
|-----------------|--------------------------|----------|
| 26 11 7 610 061 | Flexible disc | 1 |
| 26 11 7 635 643 | Hexagon head bolt | 6 |
| 26 12 7 536 563 | Self-locking hexagon nut | 6 |
| 18 30 7 577 959 | Sealing ring | 2 |
| 18 30 7 597 650 | Collar nut | 4 |

UPDATE! WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

| | | |
|--------------------------|-------------------------|---|
| Defect Code: | 0026290100 | |
| | | |
| Labor Operation: | Labor Allowance: | Description: |
| 00 64 223 | Refer to KSD2 | Replacing the flexible disc for the propeller shaft (Main work) |
| Or: | | |
| 00 64 756 UPDATE! | Refer to KSD2 | Replacing the flexible disc for the propeller shaft (Plus work) |

UPDATE! If you are using a Main labor code for another repair, use the Plus code labor operation 00 64 765 instead.

ATTACHMENTS

View PDF attachment [SI B260516 Customer Notification Letter](#).

[Copyright ©2017 BMW of North America, Inc.]