



# Preliminary Information

## PIP5521 Malfunction Indicator Lamp MIL On DTC P0871 Or P2714 Set In The TCM

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Spark	2014 - 2017	All	All	All	M4M MR8
Involved Region or Country		North America				
Additional Options (RPO)		None				
Condition		Some customers may comment on the operation or performance of the CVT7 transmission and/or the SES light is illuminated.				
Cause		Technicians may find codes P0871 or P2714 set in the TCM.				

### Correction:

If codes P0871 or P2714 is found to be set in the TCM please clear the codes and road test the vehicle.

If the codes do not reset no repairs should be performed and the vehicle can be returned to the customer.

If the codes reset on a 2014 or 2015 model year vehicle replace the transmission assembly.

If the codes reset on a 2016 or 2017 model year vehicle replace the valve body assembly.

If the vehicle is released to the customer because the codes did not reset during the road test and later returns with the same concern and codes P0871 or P2714 have reset follow the repair instructions based on the model year of the vehicle listed above.

### Version History

Version	1
Modified	

