



Preliminary Information

PIP5523 DTCs P1338 P1339 P133A P133B P133C P133D P133E and / or P133F Set.

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado	2017	All	All	6.6 L5P	All
GMC	Sierra	2017	All	All	6.6 L5P	All
Involved Region or Country:		North America				
Additional RPO/s:		N/A				
Condition:		A dealer may find DTCs P1338, P1339, P133A, P133B, P133C, P133D, P133E and / or P133F set.				

Correction:

Update GPCM software.

Once the GPCM has been updated:

- Turn on Ignition for 10 seconds (Glow plugs shall be commanded "on" by the ECU within these 10 seconds (coolant temperature should be below 40 °C).
- Turn off ignition.
- Wait > 100 seconds for the glowplug characterization to be performed.
- Cycle key on, the P1338 - P133F DTC(s) should be cleared and the MIL or CEL should no longer be illuminated.
- If the DTC(s) return, follow normal SI diagnostics.

Warranty Information

Labor Operation:	Description:	Labor Time:
2810055	Glow Plug Control Module Reprogramming with SPS	0.4

Version History

Version	1
Modified	

