



Preliminary Information

PIP5522A 6.0L Engine Noise and/or Misfire

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Express	2017 - 2018	All	All	6.0L L96 LC8	All
Chevrolet	LCF	2017 - 2018	All	All	6.0L L96 LC8	All
Chevrolet	Silverado HD	2017 - 2018	All	All	6.0L L96 LC8	All
GMC	Savana	2017 - 2018	All	All	6.0L L96 LC8	All
GMC	Sierra HD	2017 - 2018	All	All	6.0L L96 LC8	All
Involved Region or Country	North America					
Additional Options (RPO)	L96 LC8					
Condition	A vehicle may have a concern of engine noise and/or a misfire					
Cause	This may be caused by a broken rocker arm					

Correction:

Inspect for possible broken rocker arms that could result in the valve dropping to the cylinder, causing a catastrophic failure and the engine requires replacement due to cylinder head and block damage.

If a broken rocker arm is found check to see if the valve dropped into the cylinder if so the engine will need to be replaced.

On occasions the valve will not drop, reinstall any valve keepers and replace all the intake rocker arms.

Warranty Information

Labor Operation	Description	Labor Time
4081908	For tracking uses, use published labor times	
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	2
Modified	9/27/17 - Added 2018 Model Year

