



# Preliminary Information

 
## PIC6306 Service Engine Soon Light with P0446

### Models


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	LaCrosse	2017 - 2018	All	All	All	All
Involved Region or Country	North America					
Condition	A customer may bring their vehicle in with a SES light on. When diagnosing the concern code P0446 will be found.					
Cause	This code may have been set due to dust intrusion into the EVAP canister through the air inlet pipe.					

### Correction:


Clean filters in air inlet to EVAP canister, clean line and replace canister.  
Inlet pipe with filter housing is attached to fuel inlet pipe with zip ties.



 Disconnect air inlet pipe from EVAP canister. Remove the cover from the air inlet housing.



 Remove both filters from air inlet and blow dust out of filters with compressed air from shop air supply.



With EVAP air inlet pipe disconnected from canister blow all dust out of pipe. Install new EVAP canister, reinstall filters into inlet and reconnect air inlet pipe to canister.

Engineering is currently working on a permanent repair that will prevent this concern from reoccurring in the future.

**Warranty Information**

Labor Operation:	Description:	Labor Time:
2080938	Replace canister and clean filter assembly	.9

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



© 2016 General Motors. All Rights Reserved.