

Service Campaign Bulletin



Mercedes-Benz

Campaign No. 2017020001, August 2017

TO: ALL MERCEDES-BENZ CENTERS

SUBJECT: **Model 166 and 292, Model Year 2016**
Check Expansion Reservoir for Coolant, Replace if Necessary

Daimler AG ('DAG'), the manufacturer of Mercedes-Benz vehicles, has determined that in certain MY16 166, 292 (GLE-Class, GLE-Coupe Class) vehicles, the hose for the coolant may not make proper contact with the expansion reservoir. This may result in gradual coolant loss, leading to warning lamp indicators to be displayed in the instrument cluster. An authorized Mercedes-Benz dealership will check the expansion reservoir for coolant, and replace if necessary.

Prior to performing this Service Campaign:

- Please check VMI to determine if the vehicle is involved in the Campaign and if it has been previously repaired.
- Please review the entire Service Campaign bulletin and follow the repair procedure exactly as described.

Approximately 2273 vehicles are affected.

Order No. T-SC-2017020001

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Service Campaign Bulletin

Procedure

1.  Check lower hose connections (A, figure 1) at coolant expansion reservoir for leaks:
 - If hose connections at coolant expansion reservoir are **not** leaking **(OK)**: Procedure is complete.
 - If hose connections at coolant expansion reservoir **are** leaking **(NOT OK)**: Proceed to  step 2.



Figure 1

Note:

Record findings on repair order.

2. Replace expansion reservoir for coolant

Primary Parts Information

Qty.	Part Name	Part Number	Estimated Replacement Rate
As required	Expansion reservoir	A 166 500 00 49	7%

Note:

- Please be aware that only the part number(s) referenced in the Campaign Bulletin is/are approved for use to repair the vehicle. Repairs performed using any other part(s) will not have been performed in accordance with the campaign. Accordingly, warranty claims submitted with reference to an improper part number(s) will be denied.
- The following allowable labor operation should be used when submitting a warranty claim for this repair:

Warranty Information

Operation: Check expansion reservoir for coolant (02-9756)
Replace expansion reservoir for coolant (after check) (02-9757)

Damage Code	Operation Number	Labor Time (hrs.)
20 940 41 7	02-9756	0.2
	02-9757	0.6

**Note**

Operation Number labor times are subject to change.