

## Instrument cluster: HOLD indicator continues to be lit for a few seconds although the vehicle is moving

---

Topic number	LI54.30-P-066154
Version	4
Function group	54.30 Instrument cluster, display instruments, hazard warning device
Date	08-31-2017
Validity	Model 166 and 292 with code 805, 806 and 807.
Reason for change	Remedy adapted.
Reason for block	

---

### Complaint:

The HOLD indicator in the instrument cluster continues to be lit for a few seconds although the vehicle is moving. The brakes are free.

This situation occurs only when Eco start/stop mode is activated.

Attachments	
File	Description
HOLD shown while car at 48 kmh.pdf	Page 1: Nominal state Page 2: Actual state

### Cause:

Internal logic of the IC software.

### Remedy:

The remedial software is available with the following add-ons:

- For Regio DVD 05/17: 8085

- For Regio DVD 07/17: 8086

Note: The operation of safety and restraint systems in the vehicle is not affected by the display of the HOLD indicator during the described driving situation.

Symptoms
Communication/information / Information display / Indicator lamp / lit

Control unit/fault code
-------------------------


# XENTRY TIPS

---

Control unit	Fault code	Fault text
A1 - Instrument cluster (IC) (IC172)	-	-

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
54-0650	12V		54288 50	
54-1011	QUICK TEST		54288 50	
54-0991	UPDATE INSTRUMENT PANEL CONTROL UNIT SOFTWARE (XENTRY/DAS CONNECTED)		54288 50	




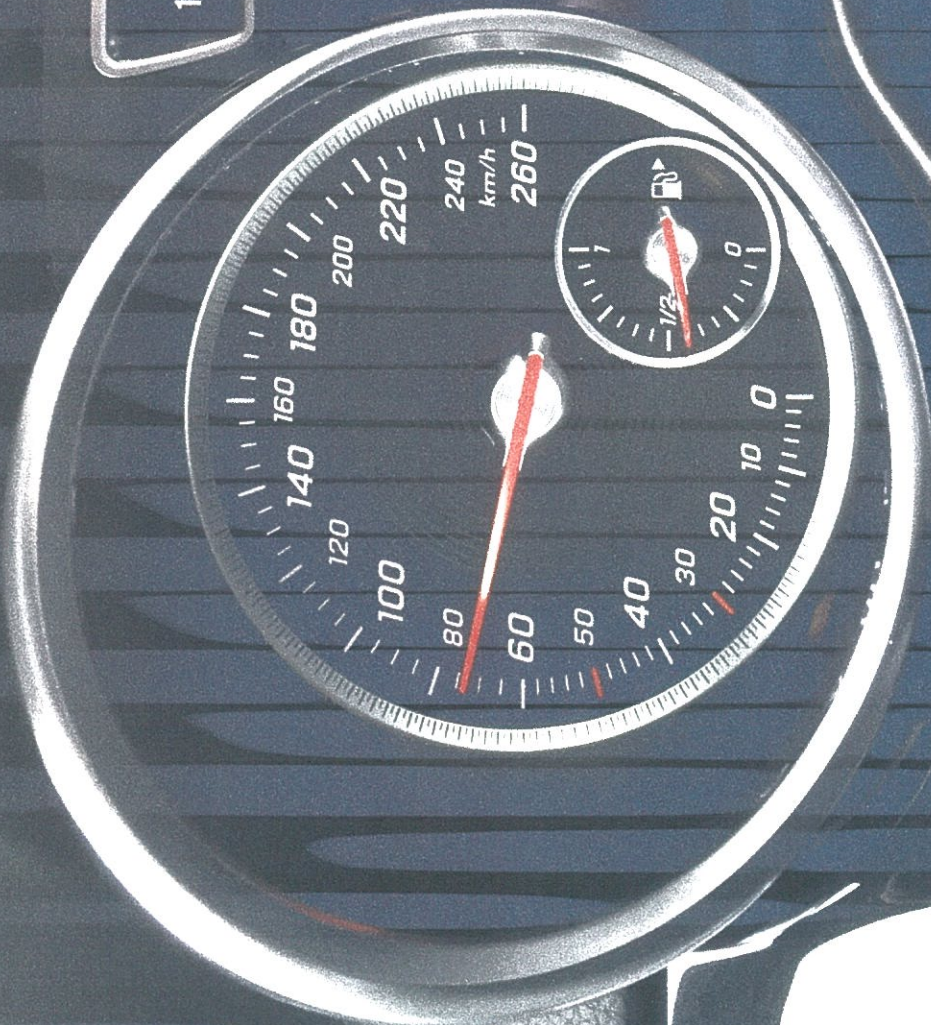

18.0°C      15:02

500.9 km  
4262

R N P  
D6

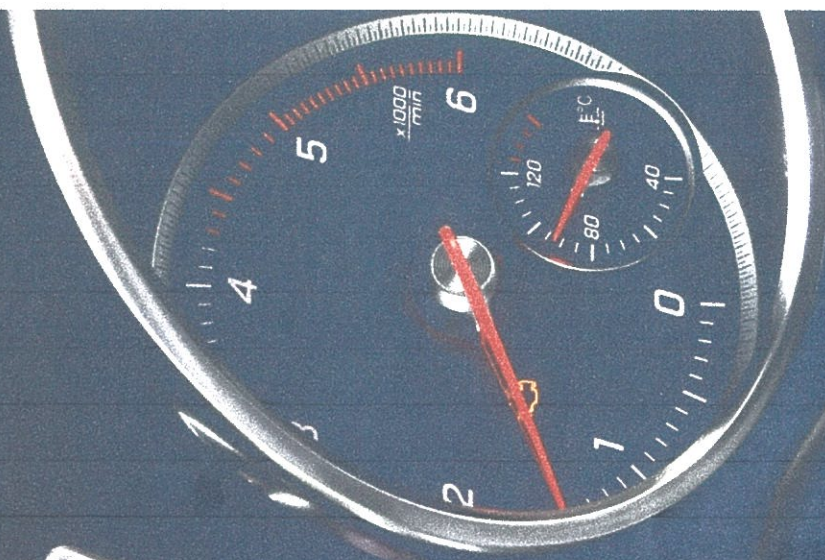





7.0°C HOLD 21:27

48 km/h

D4

