

## Rattling noises due to interaction between the 2nd seat row Bowden cable and bodyshell in trunk

---

Topic number	LI91.12-P-066989
Version	1
Function group	91.12 Rear seats
Date	08-31-2017
Validity	BR213 with SA287
Reason for change	Part number of felt strip added.
Reason for block	

---

### Complaint:

Rattling noises due to interaction between the 2nd seat row Bowden cable and bodyshell in trunk

### Cause:

The Bowden cable of the rear seat backrest release starts to oscillate due to excitation from driving on rough roads. The interaction of the Bowden cable with the bodyshell in the trunk in the area of the rear shelf produces a rattling noise.

### Remedy:

Glue two felt strips (A123 899 00 97) to the catch or joint of the rear shelf (Pic1).

Attachments	
File	Description
Pic.1.JPG	1. Left without felt strip 2. Left with felt strip 3. Right without felt strip 4. Right with felt strip

Symptoms
Body / Seat / Noises / Metallic noise
Body / Seat / Noises / Knocks
Body / Seat / Noises / Creaking

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 123 899 00 97			Felt strip	2	55x70x3mm	X

Operation numbers/damage codes

# XENTRY TIPS

---

Op. no.	Operation text	Time	Damage code	Note
			92A09 A3	Left seat backrest release cable
			92N09 A3	Right seat backrest release cable

## Attachments

Pic.1.JPG:

