



# Technical Bulletin

---

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf, Golf GTI	2015 - 2017	All	All	All	All

## Condition

**60 17 03** June 7, 2017 **2043031** Supersedes Technical Bulletin 60-16-03 (V601603) dated February 25, 2016 to include additional model year.

### Rattle or Creaking Noise from Panoramic Sunroof

A rattle or creaking noise may be heard from the rear of the Panoramic Sunroof when driving on uneven roads with the sunroof closed.

## Technical Background

Rattle or creaking noise is caused by the relative movement between the glass panel seal and body when the sunroof is closed

## Production Solution

Not applicable.



# Technical Bulletin

---

## Service

### Apply self-adhesive protective film to vehicle body:

- Cut the protective film sheet (part number AKL 448 300 04) into 3 strips 12 mm wide x 290 mm (290 mm is the length of the long side of the protective film sheet).
- Move the glass panel to the tilt open position.
- Thoroughly clean the contact area between the rear glass panel seal and the body.
- Apply the self-adhesive protective film strip to the body (Figure 1, in red).
- Close the glass panel.

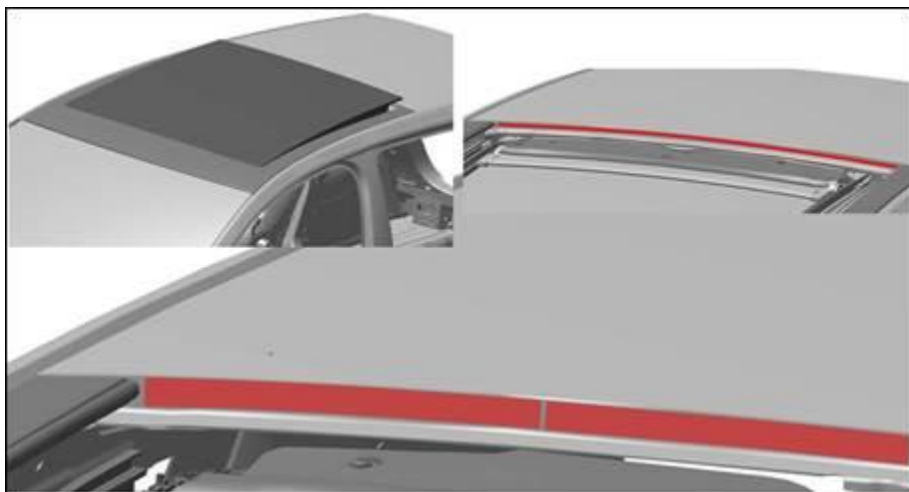


Figure 1) Area to apply the self-adhesive film (glass panel removed for illustration purposes).



# Technical Bulletin

## Warranty

To determine if this procedure is covered under Warranty, always refer to the Warranty Policies and Procedures Manual <sup>1)</sup>					
Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To
Golf, Golf GTI	2015 - 2017	All	All	All	All
<b>SAGA Coding</b>					
Claim Type:	Use applicable Claim Type <sup>1)</sup>				
Service Number:	Damage Code	HST		Damage Location (Depends on Service No.)	
6042	0010	--		Use applicable when indicated in Elsa (L/R)	
Parts Manufacturer	Golf, Golf GTI		3ME <sup>2)</sup>		
Labor Operation <sup>3)</sup> : Install self-adhesive protective film	60422399 = 30 TU				
Causal Part: Select Labor Operation	60422399				
<b>Diagnostic Time <sup>4)</sup></b>					
GFF Time expenditure	01500000 = 00 TU max.		NO		
Road Test	01210002 = 10 TU max. 01210004 = 10 TU max.		YES		
Technical Diagnosis	01320000 = 00 TU max.		NO		
Claim Comment: Input "As per Technical Bulletin 2043031" in comment section of Warranty claim.					
<sup>1)</sup> Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only <sup>2)</sup> Code per warranty vendor code policy. <sup>3)</sup> Labor Time Units (TUs) are subject to change with ELSA updates. <sup>4)</sup> Documentation required per Warranty Policies and Procedures Manual.					



# Technical Bulletin

---

## Required Parts and Tools

Part No:	Part Description	Quantity
AKL 448 300 04	Protective film	1

**Part numbers are accurate at time of publication. Always refer to ETKA for the latest part information.**

No Special Tools required.

## Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.

Document Control Revision Table			
Instance Number	Published Date	Version Number	Reason For Update
2043031/4	6/7/17	V601703	Include additional model year applicability.
2043031/1	2/1/16	V601601	Original Publication.