

Parktronic continuous warning tone

Topic number	LI54.30-P-066611
Version	1
Design group	54.30 Instrument cluster, display instruments, hazard warning device
Date	06-22-2017
Validity	BR213 and BR238 with SA code 235 (Park Assist) and 464 (All-digital instrument cluster)
Reason for change	
Reason for block	

Complaint:

The Parktronic warning tone sounds continuously from the speaker in the driver footwell.

The tone is not stopped by switching off the ignition.

Cause:

Software release in all-digital instrument cluster (widescreen cockpit). The problem can occur in rare cases when the highest Parktronic warning level is requested.

Remedy:

Do not replace any parts. Work on improved software is in progress.

The tone can be stopped in the following ways:

- Request the highest Parktronic warning level again:
 1. Drive the vehicle forwards towards an object that Parktronic can detect, until one of the warning segments (in the display) reaches the highest Parktronic warning level (flashing red at the front, see video).
 2. When the highest warning level has been reached (flashing red at the front), move the vehicle away again.

Important: The vehicle must be moved. An object moving in front of a stationary vehicle will not stop the continuous warning tone.

or

- Connect a diagnostic tester and perform a quick test.

or

- Disconnect the vehicle battery.

Attachments	
File	Description
Einparkvorgang bis letzte Stufe.mp4	Video on resetting the continuous beep. Slowly approaching an obstacle until the parking indicator reaches the last level (flashing red at the front).

XENTRY TIPS

Symptoms
Communication/information / Warning and control system / Parking assist / PARKTRONIC / Acoustic warning malfunction / Front left
Communication/information / Warning and control system / Parking assist / PARKTRONIC / Acoustic warning malfunction / Front right
Communication/information / Warning and control system / Parking assist / PARKTRONIC / Acoustic warning malfunction / General
Communication/information / Warning and control system / Parking assist / PARKTRONIC / Acoustic warning malfunction / Operates without obvious cause