

## Parking Pilot picture in COMAND display blurred

Topic number	LI54.65-P-066490
Version	1
Design group	54.65 Parking assist
Date	06-14-2017
Validity	Model 166.074, 166.075 with code 501 Model 292.374, 292.375 with code 501
Reason for change	
Reason for block	

### Complaint:

Parking Pilot picture in COMAND display blurred.

### Cause:

Water ingress in front camera.

### Remedy:

Drill hole (5 mm) in bracket (A 292 888 02 14) for camera, see attachment.

Then replace camera (A 000 905 11 03) (see WIS reference).

Attachments	
File	Description
BR292_Wasserablauf_Loch_bohren.pdf	Dimensions and position of hole

Symptoms
Communication/information / Warning and control system / Parking assist / 360° camera / Picture unsharp

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 905 11 03			Camera	1		X

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			88506 **	

WIS-References
----------------

# XENTRY TIPS

---

Document number	Title	Note	Allocation
AR54.30-P-3001GQ	Remove/install front 360° camera		Remedy

Validity		
Vehicle	Engine	Transmission
GLE (292) - 292.374	*	*
GLE (292) - 292.375	*	*
M/GLE (166) - 166.074	*	*
M/GLE (166) - 166.075	*	*