

Noise from rear shelf, seat knocks against rear wall/ rear shelf

Topic number	LI91.10-P-066537
Version	1
Design group	91.10 Front seats
Date	06-16-2017
Validity	190.477 190.480

Reason for change

Reason for block

Complaint:

Noise from rear shelf, seat knocks against rear wall/ rear shelf.

Cause:

Possible seat loss of normalization setting of limit stop.

Remedy:

1. Perform commissioning of seat control units:

To do this, select the following menu item: "Control units" -- "Seat control unit" -- "Adaptations" -- "Commissioning"

Note:

It is not necessary to replace the control unit, only to reinitiate the commissioning process.

The commissioning process, consisting of finding new software, SCN coding and normalization, must be performed individually for each seat.

During the normalization process the seats must not be occupied and there must be no objects in the area of the seats.

All other seat functions remain normal; the seat may just be slightly rubbing against the rear wall/shelf. The vehicle is still safe to drive.

Symptoms
Body / Seat / Noises / Cracking
Body / Seat / Seat adjustment / Noise
Body / Seat / Noises / Creaking
Body / Seat / Seat adjustment / Function error
Body / Interior equipment / Stowage box/tray / Noise

XENTRY TIPS

Body / Interior equipment / Interior trim / Noise

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			82A04 73	Left front seat
			82N04 73	Right front seat