

Reversing camera nonfunctional on vehicles with code 805 YoM 14/1 (MY15)

Topic number	LI54.65-P-066765
Version	1
Design group	54.65 Parking assist
Date	07-19-2017
Validity	Model series 453 code 805 YoM 14/1 (MY15) with reversing camera code 218 or V52
Reason for change	National distribution
Reason for block	

Complaint:

After the Audio/COMAND display (ZAN A40/3) is programmed and coded, the reversing camera no longer functions.

Cause:

SCN coding (for new software 8039 on vehicles with code 805 YoM 14/1 (MY15)).

Remedy:

Interim remedy:

Program old software release "7053" (A4539021906, Xentry Portal W 453 589 05 22 00) on Audio/COMAND display (ZAN A40/3) and perform SCN coding.

Then program software release "8039" (A4539020208, Xentry Portal W 453 589 07 22 00) on Audio/COMAND display (ZAN A40/3). Do not perform SCN coding afterwards!

If "7053" is no longer available, please create an XSF ticket.

Symptoms
Communication/information / Entertainment / Screen/display / Miscellaneous
Communication/information / Information display / Displays / Multifunction display / Function / Nonfunctional
Communication/information / Entertainment / Overall system/system error / System operable/Display faulty

Control unit/fault code		
Control unit	Fault code	Fault text
A40/3 - Audio/COMAND display (ZAN) (MFD453)	-	-

XENTRY TIPS
