

Gap forms in seat cushion cover at side panel

Topic number	LI91.18-P-066760
Version	1
Design group	91.18 Seat covers
Date	07-18-2017
Validity	213.064, 213.088, 213.089, 213.264, 213.288, 213.289
Reason for change	
Reason for block	

Complaint:

Gap formation between seat cushion cover and side panel of seat.

Cause:

Dimensioning of seat cushion cover.

Remedy:

Insert the spacer under the fabric as described in the instructions if the gap is not OK following visual inspection. The seat cover is not replaced.

Operation step 1: Visual inspection

-> Clearly visible hole and/or fraying -> cover not OK (see instructions, page 1)

-> Narrow gap without fraying -> cover OK (see instructions, page 1)

Operation step 2: Move seat and prepare spacer

-> Move seat forward and upward (see instructions, page 2)

-> Remove film from bonding surface of spacer (A 124 695 00 33) (see instructions, page 2).

Operation step 3: Lift side bolster and insert spacer

-> Push side bolster of seat toward vehicle center and lift (see instructions, page 3)

-> Push spacer, bonding surface first, into opening (see instructions, page 3)

Operation step 4: Fit cover

-> Slide cover over spacer and carefully pull it down (see instructions, page 4)

Operation step 5: Stroke side bolster toward spacer

-> Stroke side bolster toward spacer (see instructions, page 5)

XENTRY TIPS

Attachments

File	Description
Arbeitsanweisung_Spaltbildung_Sitzkissen_BR213_AMG.pdf	Work instructions

Symptoms

Body / Seat / Seat cover / Detaches

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 124 695 00 33			Spacer	1	1 spacer per seat.	X

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			91A04 **	Do not replace seat cushion cover.

nicht in Ordnung



in Ordnung



A 124 695 00 33









