

Noise complaints from backrest locks (2nd seat row)

Topic number	LI91.12-P-064631
Version	2
Function group	91.12 Rear seats
Date	07-20-2017
Validity	117,156,176,246, 242 S205
Reason for change	BR 242 added.
Reason for block	

Complaint:

Noises from the area of the backrest locks (2nd seat row).

Cause:

Material pairing in locking mechanism.

Remedy:

Apply the special lubricant to the right and left backrest locks as follows:

1. Fold down the rear seat backrest (Pic1).
2. Apply a thin coat of special lubricant to the marked surfaces on the backrest lock using a brush:
 - Lower area of locking unit (Pic2).
 - Upper area of locking unit (Pic3).

Important: The special lubricant must not be applied to the outer surfaces (danger of staining).

Attachments	
File	Description
Pic1.jpg	Fold down rear seat backrest
Pic2.jpg	Application of special lubricant to locking unit of folded rear backrest (brush or pipette)
Pic3.jpg	Application of special lubricant to locking unit of folded rear backrest (brush or pipette)

Symptoms
Body / Seat / Seat adjustment / Noise

Parts						
Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 000 989 36 60			Special lubricant	1	Use as required	X

XENTRY TIPS

Operation numbers/damage codes

Op. no.	Operation text	Time	Damage code	Note
			92A23 36	Left backrest lock of rear seats
			92N23 36	Right backrest lock of rear seats

Attachments

Pic1.jpg:



Pic2.jpg:



XENTRY TIPS

Pic3.jpg:

