

## Window lifter reverses direction

---

Topic number	LI72.40-P-065822
Version	3
Function group	72.40 Door control
Date	09-25-2017
Validity	MODEL 213
Reason for change	Remedy adapted.
Reason for block	

---

### Complaint:

Window lifter reverses direction on reaching upper end position.

### Cause:

Software adjustment in door control unit (DCU-xx).

### Remedy:

Perform SCN coding and normalization of the door control unit (N69/X).

Normalization: The power window system must undergo teach-in by completely opening and closing the side window pane twice "manually" (press power window switch to 1st notch only).

### Note:

In rare cases the complaint may be caused by another mechanism.

If the complaint reoccurs, the power window system must be first denormalized and then renormalized using XENTRY Diagnostics (XD).

Symptoms
Body / Glazing / Window lifting mechanism/window operation / Remains stationary
Body / Glazing / Window lifting mechanism/window operation / Does not run up
Body / Glazing / Window lifting mechanism/window operation / Stiff/sluggish
Body / Glazing / Window lifting mechanism/window operation / Opens by itself

Control unit/fault code		
Control unit	Fault code	Fault text
N69/1 - Left front door (DCU-LF) (DMFL213)	-	-
N69/2 - Right front door (DCU-RF) (DMFR213)	-	-

# XENTRY TIPS

---

N69/3 - Left rear door (DCU-LR) (DMRL213)	-	-
N69/4 - Right rear door (DCU-RR) (DMRR213)	-	-

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
			72220 GR	
			72230 GR	
			73A30 GR	
			73N30 GR	

Validity		
Vehicle	Engine	Transmission
E (213)	*	*