

Display in IC "Check engine oil pressure control"

Topic number	LI18.00-P-067096
Version	2
Function group	18.00 General
Date	09-29-2017
Validity	MODEL 197
Reason for change	Grammar
Reason for block	

Complaint:

Oil pressure too low, drops partially - Display in IC "Check Engine Oil Pressure Control"

Cause:

Crankcase vent line may briefly produce an excessively high vacuum < 60 mbar in certain driving conditions.

Remedy:

Replace vent line.

Symptoms

Power generation / Engine lubrication/oil cooling / Indicator lamp / Engine oil pressure indicator lamp / lit

Control unit/fault code

Control unit	Fault code	Fault text
N3/10 - Motor electronics 'ME97 AMG' for combustion engine 'M156' (ME) (ME97AMG)	3767	The oil pressure is too low.

Parts

Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 159 010 03 00			Vent line	1		X

Validity

Vehicle	Engine	Transmission
*	159	*
SLS (197)	*	*

