

## Creaking or knocking noise in left or right front seat backrest with equipment code 403 - Airscarf head area heating

---

Topic number	LI91.29-P-065542
Version	3
Function group	91.29 Seats - electrical system
Date	10-16-2017
Validity	A205, A238 with code 403
Reason for change	BR238 added, creaking noise added
Reason for block	

---

### Complaint:

Creaking or knocking noise in left or right front seat backrest with equipment code 403 - Airscarf head area heating

### Cause:

Retaining plate for electrical lines or connectors may come into contact with the backrest's spring mounting when driving.

### Remedy:

Note: The different routing of the lines between the left and right seat must be strictly observed!

1. Dismantle backrest trim (see AR91.10-p-3310lw)
2. Unfasten lines from spring-mounted mat (Pic. 1 (left seat), Pic. 2 (right seat))
3. Remove retaining plate (Pic. 3, Pic. 4)
4. Felt strip (A 001 983 23 10 - Cut felt strip 40X2) to length of 80 mm and stick onto spring mounting (Pic. 5)
5. Use cable tie to bind connector assembly together (Pic.6)
6. Fix connector assembly into place on mounting for Bowden cables using cable tie (Pic. 7, Pic. 8)
7. Route lines (Pic. 9, Pic. 10) and fix in place with cable tie
8. Mount backrest trim (see AR91.10-p-3310lw)

Attachments	
File	Description
1.jpg	Pic. 1: Line (driver's seat, left)
2.jpg	Pic. 2: Line (driver's seat, right)
3.jpg	Pic. 3: Retaining plate (driver's seat, left)
6.jpg	Pic. 6: Fix connector in place using cable tie
7.jpg	Pic. 7: Connector assembly on Bowden cable (driver's seat, left)
8.jpg	Pic. 8: Connector assembly on Bowden cable (driver's seat, right)
9.jpg	Pic. 9: Line routing (driver's seat, left)
10.jpg	Pic. 10: Line routing (driver's seat, right)
4.jpg	Pic. 4: Retaining plate (driver's seat, right)
5.jpg	Pic. 5: Felt

# XENTRY TIPS

---

## Symptoms

Body / Seat / Noises / Metallic noise

Body / Seat / Noises / Knocks

Body / Seat / Noises / Creaking

## Parts


Part number	ES1	ES2	Designation	Quantity	Note	EPC
A 001 983 23 10			Felt strip 40x2	1	80 mm	X

## WIS-References

Document number	Title	Note	Allocation
AR91.10-p-3310lw	Remove/install seat-back lining on front seat backrest		Remedy

## Attachments


1.jpg:

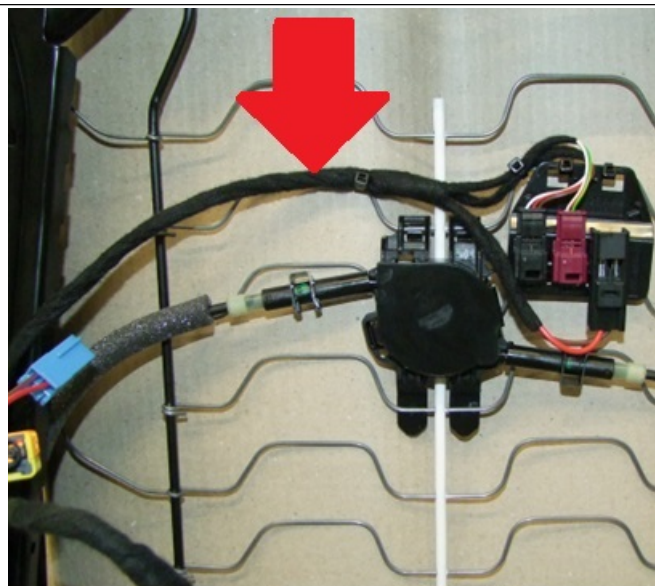


# XENTRY TIPS

---



2.jpg:

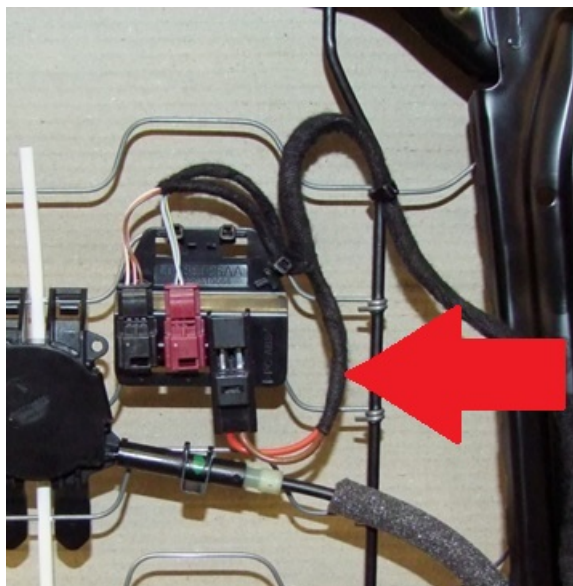

3.jpg:

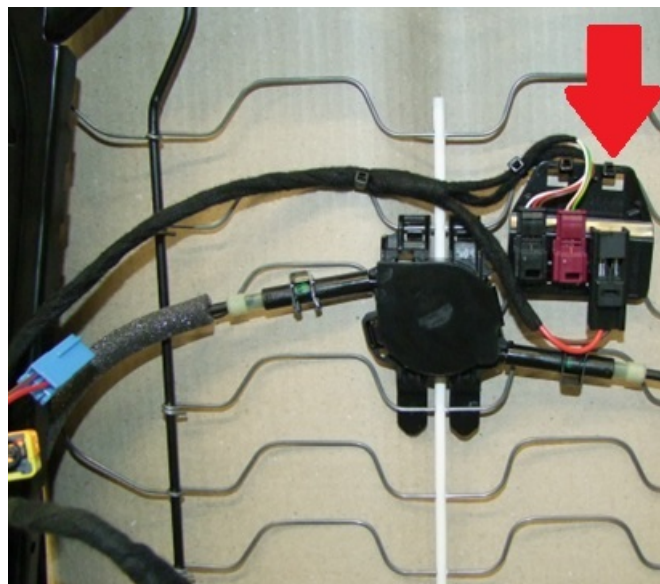


6.jpg:

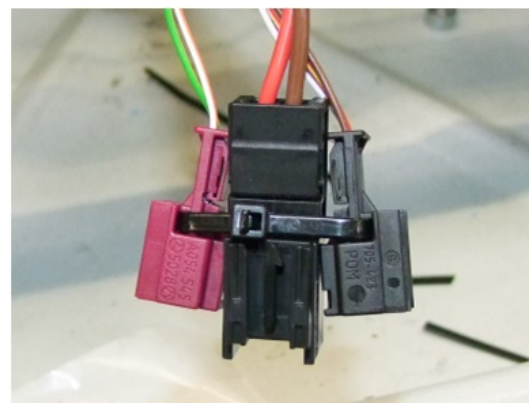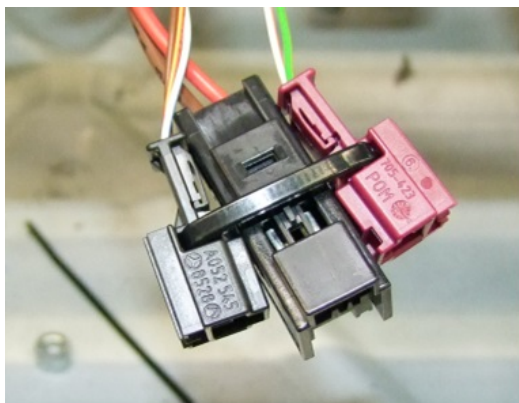


# XENTRY TIPS

---

7.jpg:

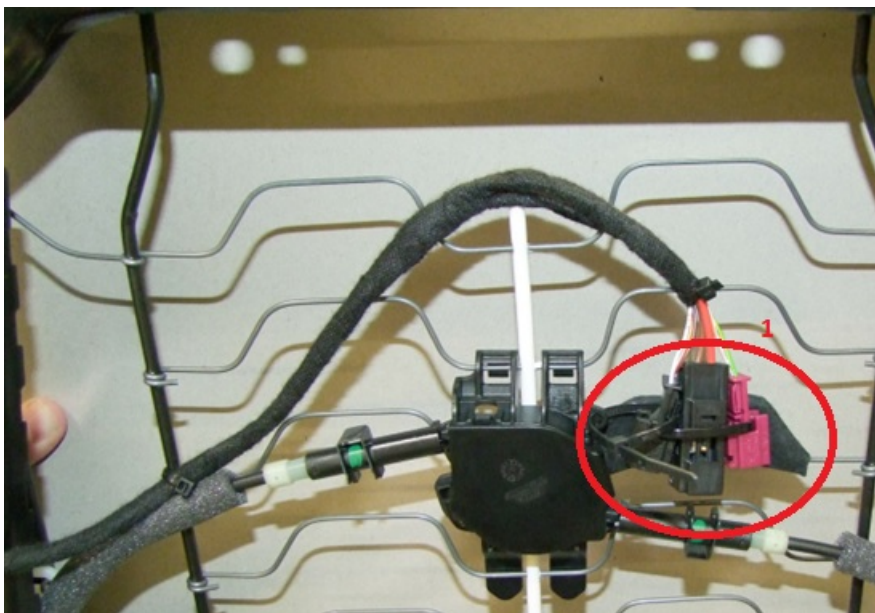


8.jpg:

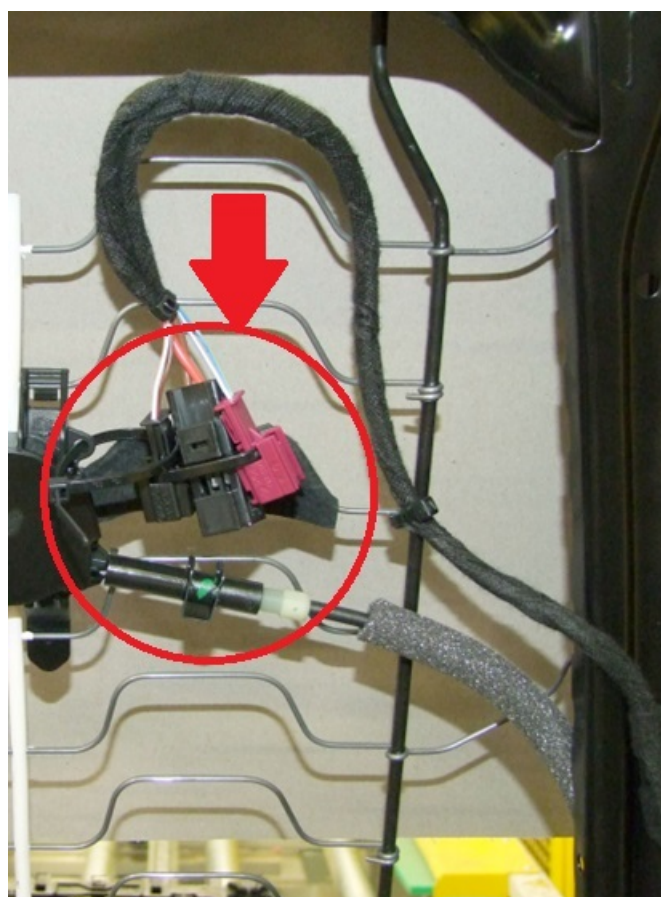


# XENTRY TIPS

---

9.jpg:

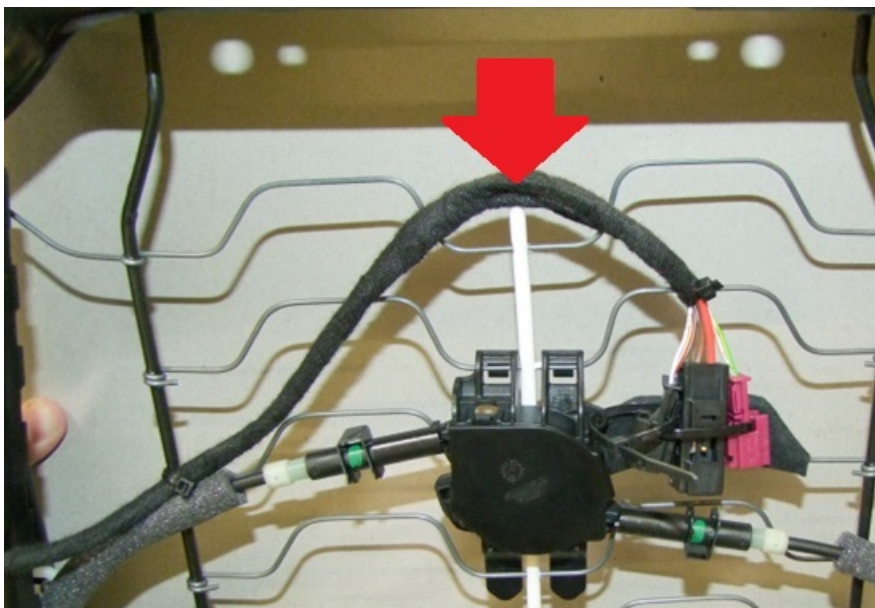


10.jpg:

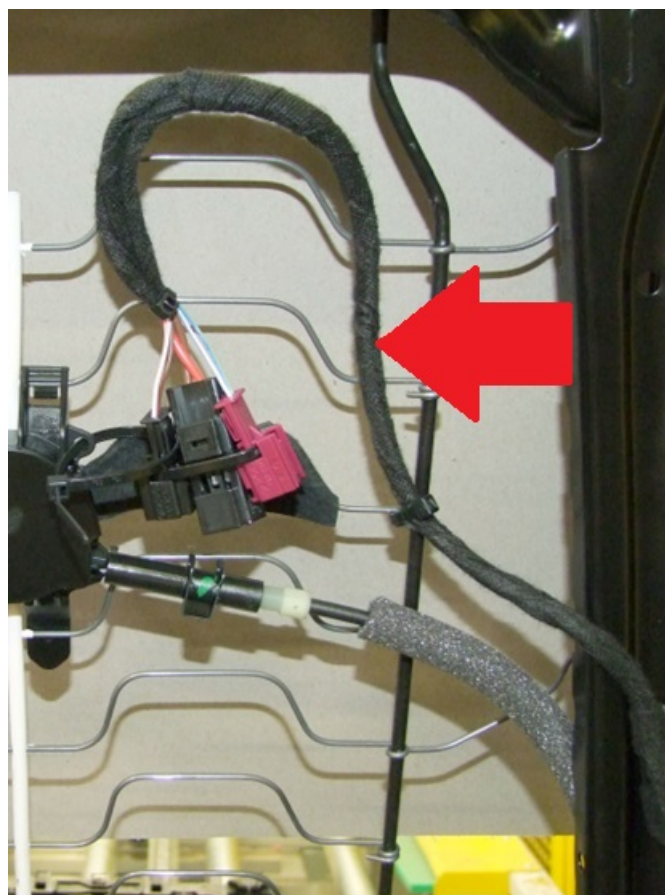

# XENTRY TIPS

---

4.jpg:

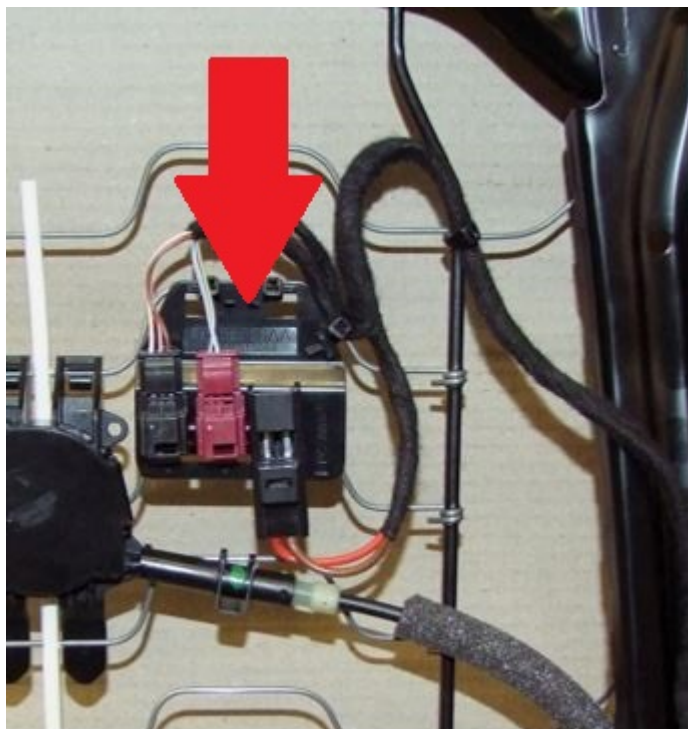

5.jpg:

