

smart media system: iPhone not charged through USB port

Topic number	LI82.70-P-067212
Version	1
Function group	82.70 Telephone, Voice-control-system(VCS)
Date	10-23-2017
Validity	Model series 453 with smart media system (SA code 556/558/535/557),
Reason for change	Software update 8046
Reason for block	

Complaint:

iPhone might not charge through USB port

Cause:

Possibly SCN coding

Remedy:

New software and new SCN coding.

1. Install the new USB software for the multifunction display (higher than "7053")

Please note that all settings on the multifunction display will be lost. The latest software is available as a download in the XENTRY Portal.

Mercedes-Benz XENTRY Portal home screen ->Maintenance & repair ->Workshop equipment ->Downloads & updates ->Software updates ->W 453 589 XXXXXX

2. When the new software has been installed, new SCN coding of the Audio/COMAND display (ZAN A40/3) must be performed.

Symptoms
Communication/information / Communication / Mobile phone / Telephone / Telephone is not charged

Operation numbers/damage codes				
Op. no.	Operation text	Time	Damage code	Note
54-0991			8270D EN	8270D USB port EN - Device is not recognized/charged