

## Reversing camera nonfunctional on vehicles with code 805 YoM 14/1 (MY15)

---

Topic number	LI54.65-P-066765
Version	2
Function group	54.65 Parking assist
Date	10-25-2017
Validity	BR453 code 805 YoM 14/1 (MY15) with reversing camera, code 218 or V52
Reason for change	Remedy, new SCN available
Reason for block	

---

### Complaint:

After the Audio/COMAND display (ZAN A40/3) is programmed and coded, the reversing camera no longer functions.

### Cause:

SCN coding (for software 8039 in vehicles with code 805 YoM 14/1 (MY15))

### Remedy:

With software release 8046 (A4539022006, XENTRY Portal W 453 589 09 22 00) and the appropriate SCN coding, the reversing camera works again.

<b>Symptoms</b>
Communication/information / Entertainment / Screen/display / Miscellaneous
Communication/information / Information display / Displays / Multifunction display / Function / Nonfunctional
Communication/information / Entertainment / Overall system/system error / System operable/Display faulty

<b>Control unit/fault code</b>		
Control unit	Fault code	Fault text
A40/3 - Audio/COMAND display (ZAN) (MFD453)	-	-