

Service Bulletin

File in Section:

Bulletin No.: 17-NA-306

Date: October, 2017

TECHNICAL

Subject: Seat Track Squeak Noise


Brand: Model:		Model Year:		VIN:		Engine:	Transmission:
Біапи.	woder.	from	to	from	to		
Buick	Enclave	2018	2018	SOP	Sep.	AII	All
Chevrolet	Traverse	2018	2018	50P	12, 2017	All	All

Involved Region or Country	North America and N.A.Exports	
Condition Some customers may comment on a squeak noise originating from the seat tra		
Cause	This may be due to lack of grease on the seat track.	
Correction	Apply grease to the seat track.	

Service Procedure

If you encounter a vehicle with the above concern, complete the following:

1. Move the seat as far forward as possible.

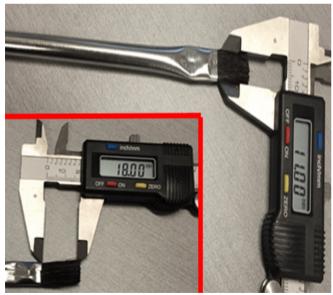

4870353



4870354

- 2. Using a brush with the approximate measurements illustrated above, apply grease to the inner and outer surface of the seat track lower channel.
- 3. Return seat to original position and verify that condition is corrected.

Parts Information

Causal Part	Description	Part Number	
N/A*	LUBRICANT, SYNTHETIC MULTI- PUPOSE	12371287 (Canadian #10953437) or Equivalent	

^{*} For warranty transactions, DO NOT mark this/these parts as the Causal Part. Enter the word "Bulletin" in the Causal Part Description free-flow text field.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time	
7080478*	Apply Grease to Seat Track	0.4 hr	
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.			

Version	1
Modified	Released September 25, 2017