



Technical Journal

TITLE:

Recall R89712: Airbag Inflator

| | | | |
|--|--|--|-----------------------------------|
| REF NO: TJ 32261.1.3 | ISSUING DEPARTMENT: Technical Service | CAR MARKET: United States and Canada | |
| PARTNER: 3 US 7510 Volvo Car USA | | ISSUE DATE: 2017-02-28 | STATUS DATE: 2017-03-09 |
| FUNC GROUP: 8840 | FUNC DESC: Seat belt and other restraining systems | Page 1 of 6 | |

“Right first time in Time”

Attachment

| File Name | File Size |
|----------------------------|-----------|
| QBI-500052-3_1_0_en-US.pdf | 1.0244 MB |

Vehicle Type

| Type | Eng | Eng Desc | Sales | Body | Gear | Steer | Model Year | Plant | Chassis range | Struc Week Range |
|------|-----|----------|-------|------|------|-------|------------|-------|---------------|------------------|
| 134 | | | | | | | 2017-2017 | | - | 0-0 |
| 137 | | | | | | | 2017-2017 | | - | 0-0 |
| 155 | | | | | | | 2017-2017 | | - | 0-0 |
| 156 | | | | | | | 2017-2017 | | - | 0-0 |
| 157 | | | | | | | 2017-2017 | | - | 0-0 |

CSC Customer Symptom Codes

| Code | Description |
|------|--------------------------------------|
| XW | Service/repair/Service action/Recall |

VST Operation Number

| VST Operation Number | Description |
|----------------------|--------------------------------|
| 97177 | Front Seat Airbag (1) Replace |
| 97178 | Front Passenger Airbag replace |



DTC Diagnostic Trouble Codes

Rows beginning with * are modified

Note! If using a printed copy of this Technical Journal, first check for the latest online version.

Text

DESCRIPTION:

* Parts information deleted in bulletin

Volvo Car USA LLC and Volvo Car Canada LTD (Volvo) on behalf of Volvo Car Group has decided to launch Recall R89712 on certain model year 2017 S60, S60CC, V60, V60CC, XC60 vehicles.

The affected vehicles may have been equipped with front passenger and/or front seat side airbag inflators that do not meet specifications, and fail to deploy in the event of a crash. This could increase the risk of injury to the occupants.

SERVICE:

The corrective action is to replace the affected front passenger and/or front seat side airbag modules.

VEHICLE REPORT:

NA

To view TJ attachment continue to next page. This TJ has one attachment.



Volvo Car Customer Service

QB Instruction

| | | | |
|---------------|-------------------------------|--------------------------|----------------|
| Title | Recall R89712 Airbag Inflator | Page | 1 (4) |
| Action | Replacement | Operation number: | 97177 97178 |


| Issue | Date | Reason |
|--------------|-------------|---------------|
| 1 | 2016-12 | First issue |

Affected vehicles


| Model year | Model |
|-------------------|-------------------|
| 2017 | S60 (11-) |
| 2017 | S60 Cross Country |
| 2017 | V60 |
| 2017 | V60 Cross Country |
| 2017 | XC60 |

Removal

Note! Removal steps in this procedure may contain installation details.

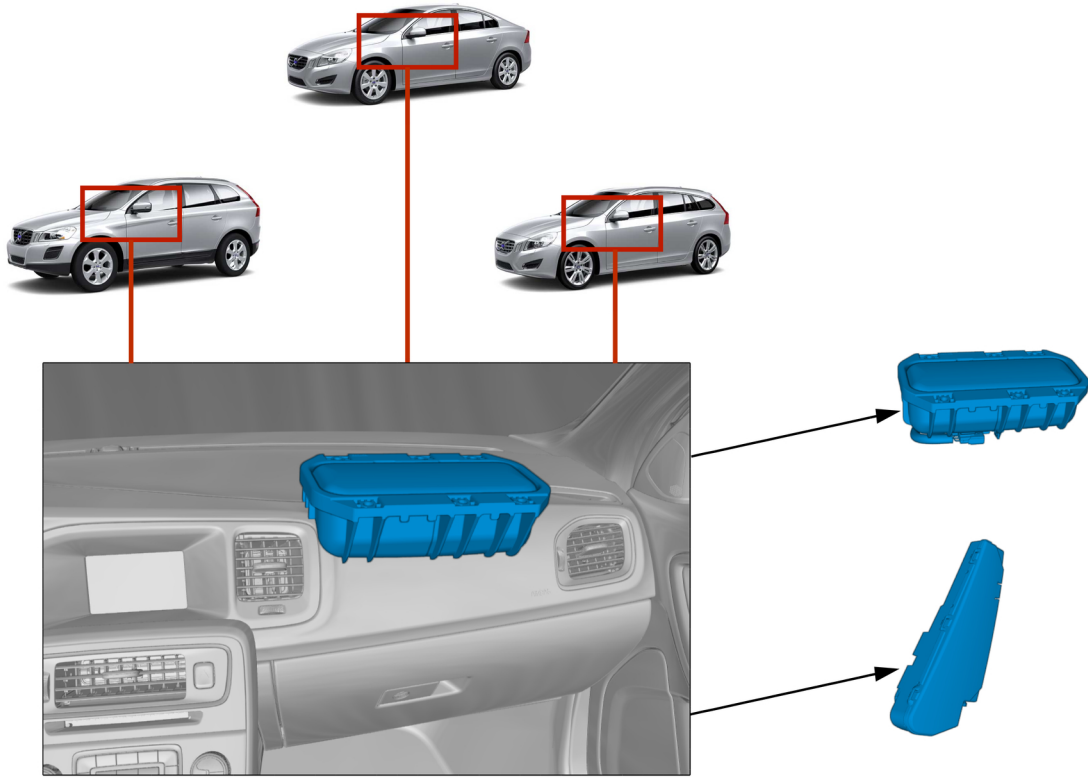


Color symbols

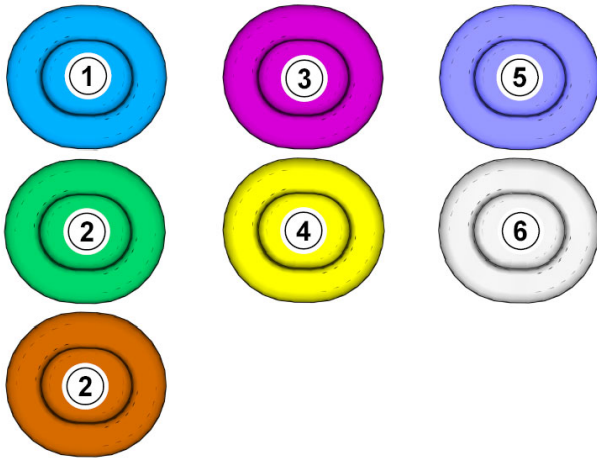

Note! This colour chart displays (in colour print and electronic version) the importance of the different colours used in the images of the method steps.

- 1 . Used for focused component, the component with which you will do something.
- 2 . Used as extra colors when you need to show or differentiate additional parts.
- 3 . Used for attachments that are to be removed/installed. May be screws, clips, connectors, etc.
- 4 . Used when the component is not fully removed from the vehicle but only hung to the side.
- 5 . Used for standard tools and special tools.
- 6 . Used as background color for vehicle components.

Remove airbag passenger side , refer to:
Removal, replacement and installation
8 - Body and interior
88 - Interior equipment
884 - seat belt and other restraining systems

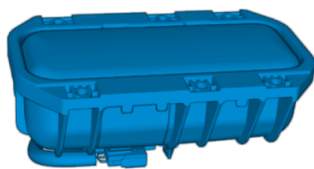

. To install, reverse the removal procedure

Remove airbag front seat , refer to:
Removal, replacement and installation
8 - Body and interior
88 - Interior equipment
884 - seat belt and other restraining
systems



Installation

To install, reverse the removal procedure.