



Technical Journal

TITLE:

New Remote Controls and Shells for XC90/S90

REF NO:
TJ 30794.1.0

ISSUING DEPARTMENT:
Technical Service

CAR MARKET:
United States and Canada

PARTNER:
3 US 7510 Volvo Car USA

ISSUE DATE:
2017-01-13

STATUS DATE:
2017-01-18

FUNC GROUP:
3669

FUNC DESC:
Miscellaneous

Page 1 of 4

“Right first time in Time”

Attachment

File Name	File Size
TJ_30794.pdf	0.7166 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
234							2017-9999		0000350-9999999	201617-999952
256							2016-9999		0000561-9999999	201505-999952

CSC Customer Symptom Codes

Code	Description
IJ	Remote control/Mechanical problem/Key unit only
XI	Remote control/Does not work

VST Operation Number

VST Operation Number	Description
36635-2	Remote control ignition key replacement

DTC Diagnostic Trouble Codes

Text



DESCRIPTION:

The remote control shell fastening concept has been changed to solve issues with the shells coming loose.

Remote controls and shells of the new design are not compatible with remote controls and shells of old design, and vice versa.

There are physical differences in the parts.

Identifying which design a remote control has can also be done by checking the 4-digit date code.

Remotes produced from Day 1, Week 49, Year 2016 (Date code 1496) are of the new design.

See attached TJ_30794.pdf.

The date code is decoded this way:

Digit 1 = Week day

Digit 2 & 3 = Week

Digit 4 = Year

For example date code "1496" = Day 1, Week 49, Year 2016.

The new part numbers are:

31652163	Remote Control, Standard
31652166	Remote Control, Inscription, R-DESIGN, First Edition
31659802	Remote Control, Red Key
31652171	Shell Standard
31652172	Shell Charcoal
31652173	Shell Blonde
31652174	Shell Amber
31652175	Shell R-Design
31652191	Shell Maroon
31659798	Shell Red Key
31659816	Shell Flame Birch Wood
31659817	Shell Linear Wood
31652207	Shell Blonde Excellence
31652208	Shell Charcoal Excellence & First Edition

SERVICE:

If a remote control or shell of the old design is replaced with a new part of the new design, then both the remote control and shell needs to be changed to the new design.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support Not Needed", use function group 3669.

To view TJ attachment continue to next page. This TJ has one attachment.



