



Technical Journal

TITLE:

Rattling noise when closing front door

REF NO: TJ 32381.1.0	ISSUING DEPARTMENT: Technical Service	CAR MARKET: United States and Canada	
PARTNER: 3 US 7510 Volvo Car USA		ISSUE DATE: 2017-02-24	STATUS DATE: 2017-02-24
FUNC GROUP: 8311	FUNC DESC: Side door, complete	Page 1 of 3	

“Right first time in Time”

Attachment

File Name	File Size
TJ32381.jpg	0.1055 MB

Vehicle Type

Type	Eng	Eng Desc	Sales	Body	Gear	Steer	Model Year	Plant	Chassis range	Struc Week Range
234							2017-9999		0000350-9999999	201617-999952
235							2017-9999		0000160-9999999	201646-999952
236							2017-9999		0000098-9999999	201646-999952

CSC Customer Symptom Codes

Code	Description
F9	Doors/Squeak/rattle/When opening/closing
G8	Doors/Squeak/rattle/Front side door

VST Operation Number

VST Operation Number	Description
83119	SIDE DOOR CPL

DTC Diagnostic Trouble Codes



Text

DESCRIPTION:

VIDA: Vehicle Information and Diagnostics for Aftersales

When closing the front or rear door a rattle noise may occur from the middle of the outer door panel.

SERVICE:

Remove door panel and window lift according to VIDA.

Apply new sealing compound ~20-30 cm (8 to 11 inches) on top of the original glue on the upper part of the beam, so that you get contact between the beam and the outer door panel.

Do not push the outer door panel when applying the glue, see attached picture [TJ32381.jpg](#). Diameter of the glue: Ø8 mm.

P/N: 1161767 (VIDA P/N) replaced by
Volvo Chemical Portal US P/N: 08901002
Volvo Chemical Portal Canada P/N: 890.1003

Install window lift and door panel according to VIDA.

VEHICLE REPORT:

Yes, please submit a Vehicle Report if the service solution described in this TJ has no effect. Use concern area "Vehicle Report" and sub concern area "Support not needed", use function group 8311.

To view TJ attachment continue to next page. This TJ has one attachment.

