Service Bulletin

Mazda North American Operations Irvine, CA 92618-2922



© 2017 Mazda Motor of America, Inc.

Subject:
VIBRATION FELT THROUGH FLOOR / SEAT / STEERING WHEEL AT APPROX.
25 - 30 MPH

Bulletin No: 03-001/17

Last Issued: 01/09/2017

BULLETIN NOTE

This bulletin supersedes the previously issued bulletin(s) listed below: The changes are noted in Red beside the change bars.

Previously issued TSBs:	Date issued:	
03-003/16	08/11/2016	

APPLICABLE MODEL(S)/VINS

2013-2016 CX-5 vehicles equipped with automatic transmission

2014-2017 Mazda6 vehicles equipped with automatic transmission

DESCRIPTION

Some customers may complain about a vibration that is felt through the floor, seat and/or steering wheel while driving under moderate acceleration, at speeds of approx. 25 - 30 mph (40 - 50 km/h). The vibration is more noticeable when driving on smooth, flat roads.

The vibration may be caused by wear on the inner surface of the tripod joint case (inner side of front drive shaft). To eliminate this concern, a coating has been applied to the inner surface of the tripod joint case to improve wear resistance.

Customers having this concern should have their vehicle repaired using the following repair procedure.


REPAIR PROCEDURE

- 1. Verify the customer concern.
- 2. Replace the inner joint set for the left and right drive shafts. Refer to MS3 online Workshop Manual:
 - CX-5 FRONT DRIVE SHAFT REMOVAL/INSTALLATION and FRONT DRIVE SHAFT (TRIPOD JOINT) DISASSEMBLY/ASSEMBLY.
 - Mazda6 FRONT DRIVE SHAFT REMOVAL/INSTALLATION and FRONT DRIVE SHAFT (TRIPOD JOINT) DISASSEMBLY/ASSEMBLY.
- 3. Verify the repair.

Page 1 of 4

Bulletin No: 03-001/17	Last Issued: 01/09/2017
© 2017 Mazda Motor of America, Inc.	

Parts Location:

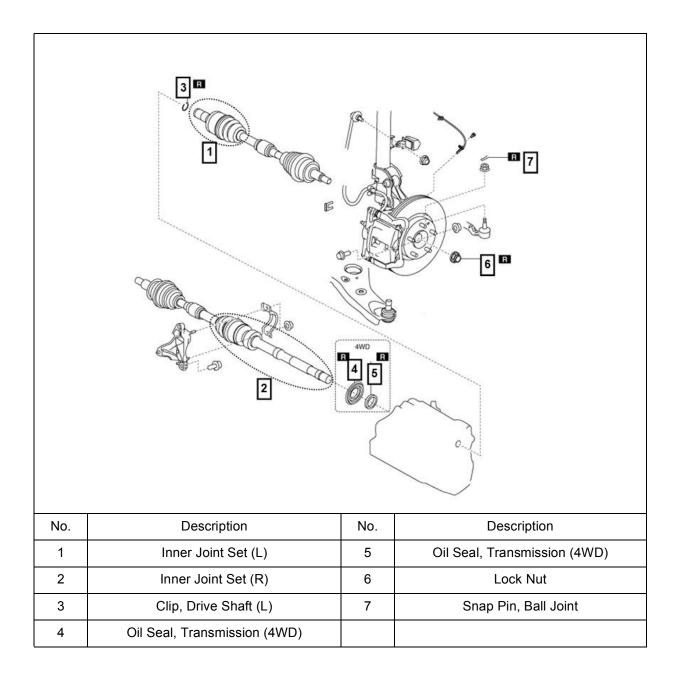

Bulletin No: 03-001/17
© 2017 Mazda Motor of America, Inc.

Last Issued: 01/09/2017

PART(S) INFORMATION

CX-5

Part Number	Description	Qty.	Notes
FTY0-22-620	Inner Joint Set (L)	1	All
FTY0-22-520	Inner Joint Set (R)	1	2.0L, A/T, 2WD
FTY1-22-520	Inner Joint Set (R)	1	2.0L, A/T, 4WD
FTY2-22-520	Inner Joint Set (R)	1	2.5L, A/T, 2WD
FTY3-22-520	Inner Joint Set (R)	1	2.5L, A/T, 4WD
H010-25-421A	Clip, Drive Shaft (L)	1	
CN01-27-397	Oil Seal, Transmission (4WD)	1	
KN01-27-398	Oil Seal, Transmission (4WD)	1	Non-reusable part
D651-33-042A	Lock Nut	2	
T060-26-169A	Snap Pin, Ball Joint	2	

Mazda6

Part Number	Description	Qty.	Notes
FTY0-22-620	Inner Joint Set (L)	1	
FTY0-22-520	Inner Joint Set (R)	1	
H010-25-421A	Clip, Drive Shaft (L)	1	Non-reusable part
CN01-27-397	Oil Seal, Transmission (4WD)	1	
D651-33-042A	Lock Nut	2	
T060-26-169A	Snap Pin, Ball Joint	2	

Bulletin No: 03-001/17	Last Issued: 01/09/2017
© 2017 Mazda Motor of America, Inc.	

WARRANTY INFORMATION

NOTE:

ı

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's Powertrain Limited Warranty.
- · Additional diagnostic time cannot be claimed for this repair.

CX-5 4WD Mazda6, CX-5 2WD Warranty Type Α Α Symptom Code 83 83 Damage Code 9C 9C FTY0-22-620 (Inner Joint Set (L)) Part Number Main Cause FTY0-22-620 (Inner Joint Set (L)) Quantity 1 1 XXM59ARX / 2.4 Hrs. XXM59BRX / 2.5 Hrs. Operation Number / Labor Hours: Inner Joint Set, R&R (Both sides) Inner Joint Set, R&R (Both sides) Includes: Two (2) road tests Includes: Two (2) road tests

NOTE: Claim the inner joint set (R) and replacement parts as Related Parts.