

Service Alert No: 1350

Title: 2016-2017 CX-3 EXCESSIVE WATER INTRUSION OR CONDENSATION OF HALOGEN HEADLIGHT
HEADLIGHT

2016-2017 CX-3 EXCESSIVE WATER INTRUSION OR CONDENSATION OF HALOGEN HEADLIGHT

Some customers may complain of condensation/fog inside the front halogen headlight. The halogen headlight assembly may be the cause.

Example of Light Unit With Condensation/Fog That Should Be Replaced

Heavy/large amount of condensation on the lens is not normal.




1. Verify if the condition requires repair. Refer to [TSB 09-003/16](#). Is a repair required?
 - a. Yes - Proceed to step 2.
 - b. No - This service alert does not apply.
2. Check the halogen headlight assembly lot number. Is the lot number before 69S?
 - a. Yes - Replace the headlight assembly.

Note: Verify that the new replacement part has a lot number of 69S or newer.

- b. No - proceed to step 3.

Lot Number Identification

Subjected Headlights are DB4N-51-0K0 and DB4N-51-0L0, Halogen Headlight only

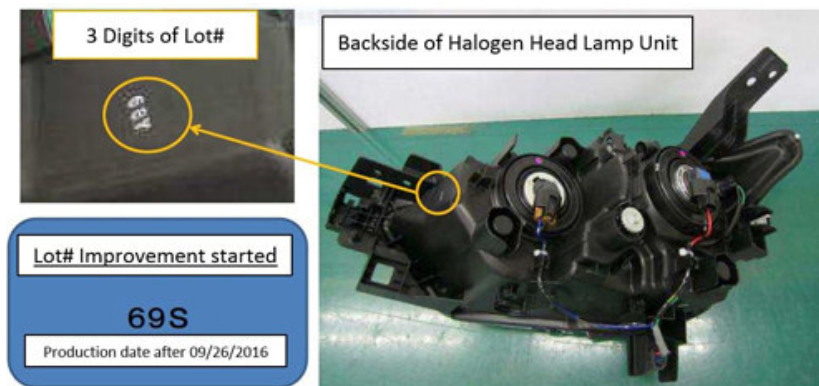

1st Digit		2nd Digit		3rd Digit	
Year	Lot	Month	Lot	Day	Lot
2015	5	1	1	1	1
2016	6	2	2	2	2
2017	7	3	3	3	3
2018	8	4	4	4	4
2019	9	5	5	5	5
2020	0	6	6	6	6

7	7	7	7
8	8	8	8
9	9	9	9
10	X	10	A
11	Y	11	B
12	Z	12	C
		13	D
		14	E
		15	F
		16	G
		17	H
		18	J
		19	K
		20	L
		21	M
		22	N
		23	P
		24	Q
		25	R
		26	S
		27	T
		28	U
		29	X
		30	Y
		31	Z

3. Check for missing halogen headlight assembly bulb seals and/or socket covers. Refer to [TSB 09-001/17](#).
Are the seals missing.
- Yes - Install missing seals.
 - No - This service alert does not apply.