

SERVICE ALERT

[Print](#)

Date: 2017-01-18

[Close](#)Service Alert
No: SA-001352

Subject: 2016 CX-9 - DTC P064A STORED DUE TO MISLOGIC DETECTION

Be aware that DTC P064A does not illuminate the MIL or wrench light.

- If DTC P064A is the only code stored and surge and/or stall symptoms **are present**, follow the instructions on MS3 online for DTC P064A diagnosis.
- If DTC P064A is stored along with other DTC(s) and surge and/or stall symptoms **are present**, follow the instructions on MS3 online for DTC P064A diagnosis first.
- If DTC P064A is stored along with other DTC(s) and surge and/or stall symptoms **are not present**, ignore the DTC P064A and diagnose the other DTC(s).

NOTE: DO NOT replace the fuel pump or fuel pump control unit if there are no DTCs stored and only the MIL or wrench light are illuminated.

NOTE: Only when there are symptoms of surging and/or stalling should the fuel system be inspected.