

<b>Subject:</b> <b>PASSENGER SEAT BELT AND PASS AIRBAG OFF INDICATOR LIGHTS ON AND / OR SEAT WARMER STAYS ON AFTER WINDSHIELD TINT INSTALL</b>	<b>M-Tips No.:</b> MT-018/17
	<b>Last Issued:</b> 11/09/2017

## APPLICABLE MODEL(S)/VINS

2017 CX-5

## DESCRIPTION


Some customers may complain about:

- PASSENGER Seat Belt and PASS AIRBAG OFF indicator lights ON (A).
- Front seat warmers ON (B) and cannot be turned OFF.



No DTC's are stored in memory. This may be caused by water contamination at connector C-56 after a recent aftermarket windshield tint installation.

### Example of water contamination

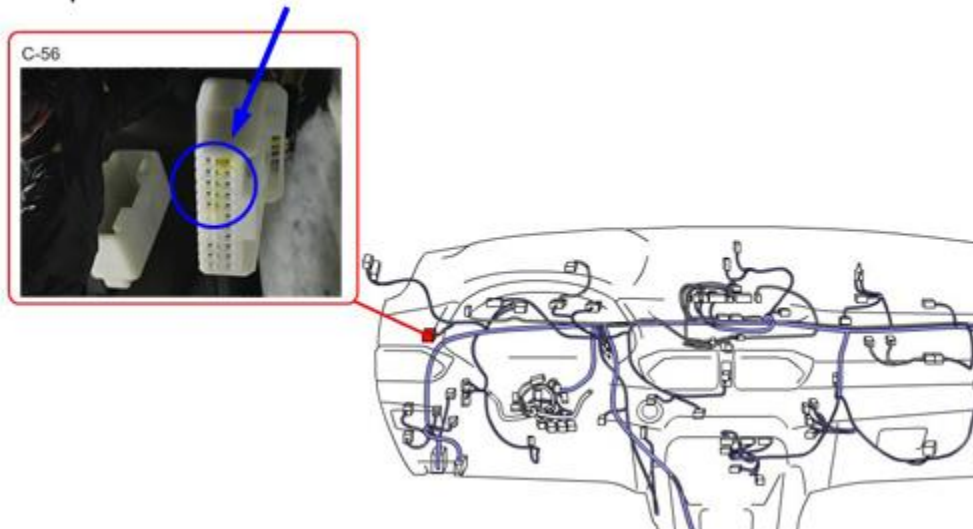

During the aftermarket windshield tint installation, water is used by the installer. The tint installation may cause water contamination at connector C-56.

### REPAIR PROCEDURE

1. Verify customer concern.
2. Inspect connector C-56 for water or corrosion.
3. Clean the connector.

**Note:** If cleaning is not possible, replace the wiring harness.

4. Verify repair.

### WARRANTY INFORMATION

This repair is not covered under Mazda's warranty policy if water contamination is found at connector C-56 after a recent aftermarket windshield tint installation.