

GPOP - Issue Review System

Part Number: 1TQ77DX9A\$

Part Description: Center Stack Lower

Issue Description: Vehicle diagnostics have revealed DTC's B10EA & B10E9. If diagnostics lead to HVAC control head replacement, The 2013 part is no longer available. Update to a 2014 HVAC control unit (1TQ77DX9AJ). When using the newer control head, minor circuit modification is required. Follow the steps below;

1. Replace HVAC control with latest 2014 part number. (1TQ77DX9AJ or later version).
2. Replace the 2013 blower power module with a 2014 module (68081871AJ or later version).
3. Remove C229 circuit from Pin 1 of D3827A Blower Control C1 connector. (Pin 1 will no longer have a wire in that cavity).
4. Splice the C229 circuit to blower control circuit C56 in Pin 3 of D3827A connector.
5. Clear Faults and re-test.

~_____
Contact us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. Please include the Part Number(s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.