



March 2017

Dealer Service Instructions for:

Customer Satisfaction Notification T01 Reprogram Powertrain Control Module

Models

| 2014 - 2015 | (WK) Jeep _® Grand Cherokee |
|-------------|---|
| 2014 - 2015 | (W2) Jeep _® Grand Cherokee (EGYPT) CKD |
| 2014 - 2015 | (W3) Jeep _® Grand Cherokee CKD |

NOTE: This campaign applies only to the above vehicles equipped with a 3.0L Diesel Engine (Sales Code EXF) built from March 13,2013 through December 16,2015 (MDH 031319 through 121606).

IMPORTANT: Some of the involved vehicles may be in dealer used vehicle inventory. Dealers should complete this campaign service on these vehicles before retail delivery. Dealers should also perform this campaign on vehicles in for service. Involved vehicles can be determined by using the VIP inquiry process.

Subject

The Powertrain Control Module (PCM) on about 15 of the above vehicles may have received PCM software containing calibration errors when recall S49 was performed. PCM software containing calibration errors may result in the radiator cooling fan producing excessive fan noise during operation.

Repair

The PCM on involved vehicles must be reprogrammed with new software.

Customer Satisfaction Notification T01 - Reprogram Powertrain Control Module Page 2

Parts Information

No parts are required to perform this service procedure.

Special Tools

The following special tools are required to perform this repair:

> NPN wiTECH micro pod II

➤ NPN Laptop Computer

> NPN wiTECH Software

Service Procedure

Reprogram the PCM Module

NOTE: The wiTECH scan tool must be used to perform this recall. This procedure must be performed with the latest software release level. If the reprogramming flash for the PCM is aborted or interrupted, repeat the procedure.

1. Open the hood. Install a battery charger and verify that the charging rate provides 13.2 to 13.5 volts. Do not allow the charger to time out during the flash process. Set the battery charger timer (if so equipped) to continuous charge.

NOTE: Use an accurate stand-alone voltmeter. The battery charger voltmeter may not be sufficiently accurate. Voltages outside of the specified range will cause an unsuccessful flash. If voltage reading is too high, apply an electrical load by activating the park or headlamps and/or HVAC blower motor to lower the voltage.

- 2. Connect the wiTECH micro pod II to the vehicle data link connector.
- 3. Place the ignition in the "RUN" position.
- 4. Open a wiTECH Diagnostic session.
- 5. Starting at the "Select Tool" screen, select the row/tool for the wiPOD device you are using.
- 6. Enter your "User id" and "Password", and then select "Finish".
- 7. Select the "Next" tab at the bottom of the screen.
- 8. From the "Vehicle View" screen, click on the "PCM" icon.

Service Procedure (Continued)

- 9. From the "PCM View" screen select the "Flash" tab. Compare the "Current Flash Number" with the "New Part Number" listed on the "sort table". If the "Current Flash Number" is the same as the "New Part Number" continue to Step 15. If the part numbers are not the same, continue with Step 10.
- 10. With the cursor over the desired flash file, click the small green arrow button on the right side of the screen.
- 11. From the "**PCM Flash**" screen follow the wiTECH screen instructions to complete the flash.
- 12. Once the flash is complete click the "**OK**" button on the "**PCM Flash**" screen.
- 13. Select the "Clear Stored DTCs" button.
- 14. From the "PCM View" screen, compare the "Current Flash Number" with the "New Part Number" listed on the "sort table". If the "Current Flash Number" is the same as the "New Part Number" the flash is complete. Continue with Step 15. If the part numbers are not the same, repeat Steps 8 through 13.
- 15. **For vehicles equipped with a diesel engine**, perform the following steps:
 - a. Select the "Systems Test" tab.
 - b. Select "SCR DEF Tank Fluid Level Reset" from the list.
 - c. Follow the screen prompts to complete the reset procedure.
 - d. Continue with Step 16 of this procedure.
- 16. Turn the ignition to the "**OFF**" position, remove the wiTECH micro pod II and battery charger from the vehicle and then close the hood.
- 17. Return the vehicle to the customer.

Customer Satisfaction Notification T01 - Reprogram Powertrain Control ModulePage 5

Completion Reporting and Reimbursement

Claims for vehicles that have been serviced must be submitted on the DealerCONNECT Claim Entry Screen located on the Service tab. Claims submitted will be used by FCA to record Customer Satisfaction Notification service completions and provide dealer payments.

Use the following labor operation number and time allowance:

| | Labor Operation | Time |
|----------------------------|-----------------|------------------|
| | <u>Number</u> | Allowance |
| Inspect PCM Software Level | 18-T0-11-81 | 0.2 hours |
| Reprogram the PCM module | 18-T0-11-82 | 0.3 hours |

Add the cost of the parts package plus applicable dealer allowance to your claim.

NOTE: See the Warranty Administration Manual, Recall Claim Processing Section, for complete claim processing instructions.

Dealer Notification

To view this notification on DealerCONNECT, select "Global Recall System" on the Service tab, then click on the description of this notification.

Owner Notification and Service Scheduling

All involved vehicle owners known to FCA are being notified of the service requirement by mail. They are requested to schedule appointments for this service with their dealers. A generic copy of the owner letter is attached.

Enclosed with each owner letter is an Owner Notification postcard to allow owners to update our records if applicable.

Customer Satisfaction Notification T01 - Reprogram Powertrain Control ModulePage 6

Vehicle Lists, Global Recall System, VIP and Dealer Follow Up

All involved vehicles have been entered into the DealerCONNECT Global Recall System (GRS) and Vehicle Information Plus (VIP) for dealer inquiry as needed.

GRS provides involved dealers with an <u>updated</u> VIN list of <u>their incomplete</u> vehicles. The owner's name, address and phone number are listed if known. Completed vehicles are removed from GRS within several days of repair claim submission.

To use this system, click on the "Service" tab and then click on "Global Recall System." Your dealer's VIN list for each recall displayed can be sorted by: those vehicles that were unsold at campaign launch, those with a phone number, city, zip code, or VIN sequence.

Dealers should perform this repair on all unsold vehicles <u>before</u> retail **delivery.** Dealers should also use the VIN list to follow up with all owners to schedule appointments for this repair.

VIN lists may contain confidential, restricted owner name and address information that was obtained from the Department of Motor Vehicles of various states. Use of this information is permitted for this notification only and is strictly prohibited from all other use.

Additional Information

If you have any questions or need assistance in completing this action, please contact your Service and Parts District Manager.

Customer Service / Field Operations FCA US LLC



CUSTOMER SATISFACTION NOTIFICATION

T01

Dear: (Name)

At FCA US LLC, we recognize that the success of our business depends on the satisfaction of our customers. We are constantly monitoring the quality of our products and looking for opportunities to improve our vehicles even after they are sold. Because your long-term satisfaction is important to us, we are contacting you on important improvements we would like to make to your vehicle. This will be done at no charge to you.

We are recommending the following improvements be performed on certain 2014 through 2016 model year Jeep_® Grand Cherokee vehicles.

The problem is... The Powertrain Control Module (PCM) on your vehicle may have received PCM

software containing calibration errors when recall S49 was performed. PCM software containing calibration errors may result in the radiator cooling fan

producing excessive fan noise during operation.

What your dealer FCA will service your vehicle free of charge (parts and labor). To do this, your will do...

dealer will reprogram the powertrain control module. The work will take about

dealer will reprogram the powertrain control module. The work will take about 1 hour to complete. However, additional time may be necessary depending on service schedules. We recommend that you make an appointment with your dealer

to minimize your inconvenience.

What you should Simply contact your Chrysler, Jeep_®, Dodge or RAM dealer right away to schedule a

do... service appointment. Please bring this letter with you to your dealer.

If you need help... If you have questions or concerns which your dealer is unable to resolve, please contact the

FCA Group Recall Assistance Center at either **fcarecalls.com** or 1-800-853-1403.

Please help us update our records by filling out the attached prepaid postcard, if any of the conditions listed on the card apply to your vehicle. If you have further questions go to **fcarecalls.com.**

If you have already experienced this specific condition and have paid to have it repaired, you may visit www.fcarecallreimbursement.com to submit your reimbursement request online or you can mail your original receipts and proof of payment to the following address for reimbursement consideration: FCA Customer Assistance, P.O. Box 21-8004, Auburn Hills, MI 48321-8007, Attention: Recall Reimbursement. Once we receive and verify the required documents, reimbursement will be sent to you within 60 days. If you've had previous repairs and/or reimbursement you may still need to have the recall repair performed on your vehicle.

We apologize for any inconvenience this service may cause to your schedule. FCA is committed to providing our customers with world class quality products, ensuring that you have a positive dealership experience and following up on any issues and concerns that you may have in a timely manner through our Customer Assistance Center. Thank you for being our customer.