



NUMBER: 08-050-17 REV. A

GROUP: 08 - Electrical

DATE: June 29, 2017

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of FCA US LLC.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-050-17, DATED JUNE 21, 2017, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDE UPDATING THE MODEL YEAR.**

THIS SERVICE BULLETIN IS ALSO BEING RELEASED AS RAPID RESPONSE TRANSMITTAL (RRT) 17-049. ALL APPLICABLE SOLD AND UN-SOLD RRT VIN's HAVE BEEN LOADED. TO VERIFY THAT THIS RRT SERVICE ACTION IS APPLICABLE TO THE VEHICLE, USE VIP OR PERFORM A VIN SEARCH IN TECHCONNECT. ALL REPAIRS ARE REIMBURSABLE WITHIN THE PROVISIONS OF WARRANTY.

THE wiTECH SOFTWARE IS REQUIRED TO BE AT THE LATEST RELEASE BEFORE PERFORMING THIS PROCEDURE.

SUBJECT:

Incorrect Value for Distance To Service

OVERVIEW:

This bulletin involves the replacement of the Instrument Panel Cluster (IPC).

MODELS:

****2015**** (FF) FIAT 500

NOTE: This bulletin applies to vehicles within the following markets/countries: LATAM, (Brazil Only).

NOTE: This bulletin applies to vehicles equipped with a Premium Instrument Cluster W/Display (Sales Code JAV).

SYMPTOM/CONDITION:

The customer may notice when looking at the Kilometers "(km) to service" that the value is set to 30,000 km. In LATAM it should be set at 15,000 km.

DIAGNOSIS:

If a customer's VIN is listed in VIP or your RRT VIN list, perform the repair.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	5SV94JXWAE	Cluster, Instrument Panel Abarth
1 (AR)	5SV92JXWAE	Cluster, Instrument Panel Black trim
1 (AR)	5SV92JW4AE	Cluster, Instrument Panel Ivory Trim

REPAIR PROCEDURE:

NOTE: Before replacing the IPC you must use wiTECH to record information that needs to be installed in the new cluster.

1. Using wiTECH, perform the cluster replacement routine, which is found in Misc-Functions.
2. Replace the IPC. Refer to the detailed service procedures available in DealerCONNECT> TechCONNECT> 08 - Electrical/8E - Electronic Control Modules/Module, Instrument Panel Cluster/Removal/Installation.
3. Using wiTECH, complete the cluster replacement routine, which is found in Misc-Functions.
4. Clear any DTCs that may have been set in any module due to this repair procedure.
5. Using wiTECH, perform a Proxi Configuration Alignment. This routine is available under the 'Vehicle Preparations' tab found on the home page of wiTECH.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Skill Category	Amount
08-45-10-9K	Replace - Instrument Panel Cluster (IPC) (2 - Skilled)	6 - Electrical and Body Systems	0.4 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------