

9003357

07/19/2017

MY14-17

All Makes

All Bodies

GPOP - Issue Review System

Part Number: 68105583A\$, 68310865A\$, 68308741A\$, 04893647A\$

Part Description: Pentastar Oil Filter Adapter

Issue Description: All vehicles equipped with a 3.2L or 3.6L engine; If replacing the Oil Filter Adapter (OFA) due to a leak detected between OFA and block. Ensure the torque on the 5 (OFA) bolts are torqued to 12nm. If not recorded the actual values, torque to 12nm and contact the FCA employees listed below. Using dye will assist in determining source of leak. Ensure OFA Cap O-ring is seated in the proper groove in the cap and not damaged or cut. An O-ring kit (68191356AA) is now available to repair OFA/Block Interface leaks.

Engineering is seeking information regarding OFA leaks. Questions/info can be directed to:

Bob Jackson Cell (248) 944-0466 - bob.jackson@fcagroup.com

Ron Dallison Cell (248-292-9510) ron.dallison@fcagroup.com

Joe Lovell Cell (734) 309-6467 - joe.lovell@fcagroup.com

If a response is not received within 15 mins, then proceed with the necessary repair.

~_____
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquires. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.