

GPOP - Issue Review System

Part Number: 68295438A\$, 68253984A\$, 68212738A\$, 68253983A\$, 68210095A\$, 68039104A\$, 68240477A\$, 68245792A\$, 68212739A\$, 68210648A\$

Part Description: Turbocharger, Turbo Speed Sensor, Turbo Gaskets and Seals

Issue

Description: 1. Do Not Replace Turbocharger for Exhaust Brake Operation Complaints.
Do not replace the turbocharger for complaints of exhaust brake operating when the Exhaust Brake switch is off. Replacing the turbocharger will not address these complaints. Update the PCM with the new software version to correct this issue.

2. Turbo Speed Sensor is Now Serviceable.
If a Turbocharger Speed Sensor is being replaced for a P2580 or any other reason, the Turbo Speed Sensor is now available separate from the Turbocharger Kit. do not replace the entire Turbocharger Kit.
2013-2015 Chassis Cab or Pickup - PN 68210095A\$
2007-2012 Chassis Cab or Pickup - PN 68039104A\$.

3. Replace Exhaust Gaskets with Turbocharger Removal.~
If turbocharger is removed/replaced, the following items are not reusable and must be replaced:
Turbocharger Gasket
Turbocharger Outlet Seal
Turbocharger Band Clamp

If the front exhaust pipe is removed/replaced, the following items are not reusable and must be replaced.
Turbocharger Outlet Seal
Turbocharger Band Clamp

~
Contact Us at CAGRIS@Chrysler.com for feedback related ONLY to this GPOP Tech Tip. DO NOT email regarding repair procedures unrelated to this Tech Tip or part order inquiries. Please include the Part Number (s) and Tech Tip Part Description of the Tech Tip you are referencing for our tracking system.
